

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970
 Chippewa County Remonumentation Corner

SECTION

For corners in

<u>Chippewa</u>	Located In:	Corner Code #
1. Public Land Survey	SAME CORNER	M-7 ✓ A-7
2. Property Controlling in Section	S T R	
3. Miscellaneous Property in Sec.	S T R	

\$7.00 LAND CORNER
 \$2.00 HSSR
 21 JAN 1999 10:29:04 AM Receipt #1312
 RECEIVED FOR RECORD
 CHIPPEWA COUNTY - STATE OF MICHIGAN
 SHARON H. KENNEDY, REGISTER OF DEEDS

BOOK 10 PAGE 353
 Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

I, Larry R. Rogers, in a field survey on November 12, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.


1	A	B	C	D	E	F	G	H	I	J	K	L	M
2		6		5		4		3		2		1	
3													
4		7		8		9		10		11		12	
5													
6		18		17		16		15		14		13	
7													
8		19		20		21		22		23		24	
9													
10		30		29		28		27		26		25	
11													
12		31		32		33		34		35		36	
13													

A. Description of original monument and accessories and/or subsequent restoration:
(M-7) Southeast Corner of Section 13, Township 47 North, Range 1 East.
 The original corner was placed in 1845 by John Mullett. 1930 County Surveyor records indicate a 1" x 30" bolt with four witnesses. In 1976, N.D. Alix, found 1" bolt in road, recovered three County Surveyor witnesses and filed a L.C.R.C. in Liber 1, Page 225 of the Chippewa County Records. In 1982, William L. Karr, P.S. 27450 found a 1" iron 6 feet South of centerline of 3 Mile Road, but none of Alix witnesses were recited in notes.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
(M-7) Southeast Corner of Section 13, Township 47 North, Range 1 East.
 This corner is being perpetuated as part of the Chippewa County Remonumentation Program.
 Found 1" iron used by Karr - believe iron is same as 1" bolt from earlier notes. Accepted corner position as found.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
(M-7) Southeast Corner of Section 13, Township 47 North, Range 1 East.
 Corner is a 1" iron 4" below grade of 3 Mile Road (East-West, gravel) and 6 feet South of centerline.

Witnesses:		
Utility Pole	N76°E	138.86 feet
Utility Pole	N40°W	48.29 feet
8" Aspen	S28°W	59.53 feet
10" Oak	S33°E	48.09 feet

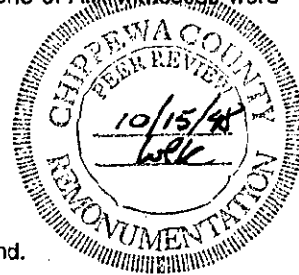

Signed by [Signature] Date 30 DEC 1998

Surveyor's Michigan License No. 29251

NOTE: All bearings are compass bearings corrected for declination (6°W). All distances are to a nail and tag in the side of witness object unless otherwise noted.

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
 REVISED MAY 14, 1975
 REVISED JAN., 1983
 REVISED OCT., 1995