## LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970 Chippewa County Remonumentation Corner

CITY TO NA For corners in

4. Lot No.

5. Private Claims

Chippewa County Located in: Corner Code # 1. Public Land Survey **T47N R1W** R Ŧ R Ŧ R 2. Property Controlling Т R in Section S T R 3. Miscellaneous S T R Property in Sec.

, Recorded Plat

BOOK 11 PAGE 55

\$7.00 LAND CORNER

\$2.00 HSSR


23 FEB 2000 3:15:30 FM Receipt #2117 RECEIVED FOR RECORD

CHIPPENA COUNTY - STATE OF MICHIGAN SHARON H. KENNEDY, REGISTER OF DEEDS

Register of Deeds Stamp & File Number

1. William L. Karr, in a field survey on December 15, 1999, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

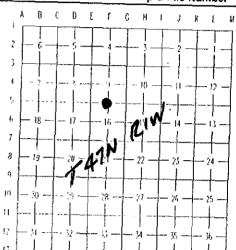

A. Description of original monument and accessories and/or subsequent restoration:

(F-5) 1/4 Corner Between Sections 9 and 16, T. 47 N., R. 1 W.

James H. Mullett set post in original survey.

Rudolph H. Larsen surveyed Plat of Lake Shore Subdivision, L.6, P.4, Chippewa County Plats. The plat shows 1947 a concrete monument at the 1/4 corner.

William L. Karr, P.S. 27450, recorded the corner, L.6, P.99, Chippewa County Corner Records. Found concrete 1983 monument matching plat monumentation.

Witnesses: Pwr Pole

Pwr Pole

N 81° E 83.90'

S 82° W 12.10

14" Aspen Pwr Pole

S 52° F

29.52

N 19° W 102.88

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

(F-5) 1/4 Corner Between Sections 9 and 16, T, 47 N., R. 1 W.

This corner is being perpetuated as part of the Chippewa County Remonumentation Program.

Accepted the corner position as shown on the plat and recorded in 1983, however, concrete monument was dug out during subsequent road and ditch reconstruction. Re-established the corner from previous survey work in the area and one existing witness.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

(F-5) 1/4 Corner Between Sections 9 and 16, T. 47 N., R. 1 W.

Corner is a 3/4" x 48" iron with an aluminum Chippewa County Remonumentation cap. The corner falls on the back slope of a ditch along the South side of 16<sup>th</sup> Ave, just East of the intersection of Lakeshore Dr.

Witnesses:

12" White Birch

N 41° E

88.92

8" Aspen 12" White Birch

S 32° W S 69° W

25.70'

Power Pole 3458/G4/6

38.36

N 21° W

102.75' (existing witness)

Bearings are compass bearings, corrected for declination (7° W), all distances are to a nail and lag in the side of the with

Signed by

Surveyor's Michigan License No. 27450

Date 12 - 24 - 99

KARR LAND **JRVEYO**F

No.

FORM APPROVED BY MICHIGAN STATE BOARD