

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970
Chippewa County Remonumentation Corner

1999

For corners in SECTION

Chippewa Located In: Corner Code #

1. Public Land Survey SAME CORNER { T 47N R 1E M-3
T 47N R 2E A-3 ✓
T ___ R ___
T ___ R ___
2. Property Controlling in Section S ___ T ___ R ___
S ___ T ___ R ___
3. Miscellaneous Property in Sec. S ___ T ___ R ___
S ___ T ___ R ___

\$7.00 LAND CORNER
\$2.00 MSSR
21 JAN 1999 11:04:44 AM Receipt #13123
RECEIVED FOR RECORD
CHIPPEWA COUNTY - STATE OF MICHIGAN
SHARON H. KENNEDY, REGISTER OF DEEDS

BOOK 10 PAGE 369
Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3			2		1
3												
4	7		8		9		10			11		12
5												
6	18		17		16		15			14		13
7												
8	19		20		21		22			23		24
9												
10	30		29		28		27			26		25
11												
12	31		32		33		34			35		36
13												

I, Larry R. Rogers, in a field survey on November 13, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
(M-3) Southeast Corner Section 1, Township 47 North, Range 1 East.

The original corner was placed in 1845 by John Mullett. Found no reference to corner in County Surveyor records. In 1981, William L. Karr, P.S. 27450 found and used a 1" axle shaft and filed a L.C.R.C. in Liber 5, Page 067 of the Chippewa County Corner Records. In 1992, Keith Waters, P.S. 33142, found and used a 1/2" iron pin but his witnesses match Karr's witnesses.


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
(M-3) Southeast Corner Section 1, Township 47 North, Range 1 East.

This corner is being perpetuated as part of the Chippewa County Remonumentation Program. Found 1" smooth iron pin 4" above grade. Matches Karr and Waters witnesses and I believe this is the same corner as both. Accepted corner position as found.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
(M-3) Southeast Corner Section 1, Township 47 North, Range 1 East.

Corner is a 1" smooth round iron pin 4" above grade and 80 feet North of the centerline of gravel pit road.

Witnesses:
16" Maple N12°W 28.42 feet
5" Maple N14°E 7.55 feet
12" Maple S39°E 8.02 feet
4" Maple S67°W 15.33 feet
Steel Fence Post North 2.00 feet

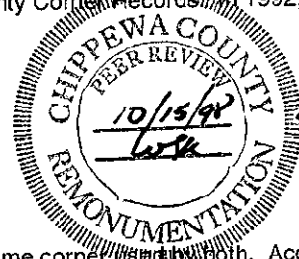

Signed by [Signature] Date 30 DEC 1998

Surveyor's Michigan License No. 29251

NOTE: All bearings are compass bearings corrected for declination (6°W). All distances are to a nail and tag in the side of witness object unless otherwise noted.

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1971
REVISED MAY 14, 1975
REVISED JAN., 1983
REVISED OCT., 1995