

FEB 23 2001

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970
 Chippewa County Remonumentation Corner

For corners in

| | | |
|------------------------------------|---------------|---------------|
| Chippewa County | Located in: | Corner Code # |
| 1. Public Land Survey | T47N R2E | F-3 |
| | T R | |
| | T R | |
| | T R | |
| 2. Property Controlling in Section | S T R | |
| | S T R | |
| 3. Miscellaneous Property in Sec. | S T R | |
| | S T R | |
| 4. Lot No. | Recorded Plat | |
| 5. Private Claims | | |

\$7.00 LAND CORNER


\$2.00 MBSR
 9 FEB 2001 10:35:53 AM Receipt #1201
 RECEIVED FOR RECORD
 CHIPPEWA COUNTY - STATE OF MICHIGAN
 SHARON H. KENNEDY, REGISTER OF DEEDS

BOOK 11 PAGE 237

Register of Deeds Stamp & File Number


I, Larry R. Rogers, P.S., in a field survey on December 08, 2000, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

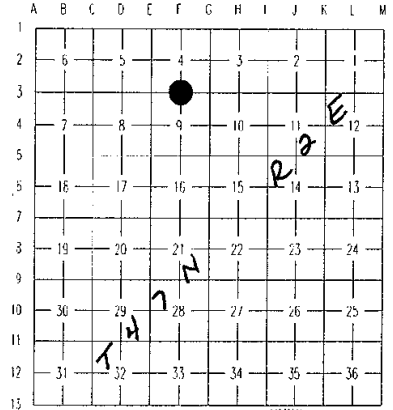

A. Description of original monument and accessories and/or subsequent restoration:
(F-3) 1/4 Corner common to Sections 4 and 9, Township 47 North Range 2 East.

A 6" Spruce was marked as the original corner by John Mullett in 1845 and no bearing trees were recorded in the original field notes. We found no mention of this corner in the County Surveyor notes.

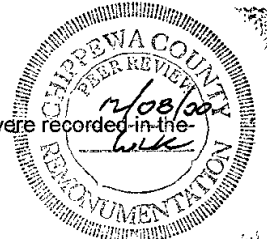

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
(F-3) 1/4 Corner common to Sections 4 and 9, Township 47 North Range 2 East.
 This corner is being perpetuated as part of the Chippewa County Remonumentation Program.

No evidence of the original corner was recovered. Re-established the corner position midway and on-line between the Southeast and Southwest corners of Section 4. Distances to Section corners to East and West measure 2644.7 feet (G.L.O. 2643.3). The stream referenced in the original field notes in now a substantial beaver flooding. No stream bed was found.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
(F-3) 1/4 Corner common to Sections 4 and 9, Township 47 North Range 2 East.

Corner is a 3/4" x 48" rebar with stamped aluminum remonumentation cap on the East edge of a small peninsula that extends southwesterly into a beaver pond.

Witnesses:

| | | |
|------------------|-------|------------|
| 8" Yellow Birch | N74°W | 14.54 feet |
| 10" Cedar | N10°W | 28.77 feet |
| 12" Red Maple | N19°E | 19.07 feet |
| 14" Red Maple | S30°W | 13.61 feet |
| Steel Fence Post | North | 1.0 feet |



Bearings are magnetic compass bearings. All distances are to a nail and tag in the side of the witness object unless otherwise noted.

Signed by [Signature]
 Larry R. Rogers, B.S.
 Surveyor's Michigan License No. 29251

Date 29 DEC 2000