

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Chippewa Co.

1 Corner

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY_____	T. <u>49</u> N. <u>7</u> E. <u>W.</u>	<u>C-12</u>
2. PROPERTY CONTROLLING IN SECTION_____	, T. _____ N. _____ S., R. _____ E. _____ W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION_____	, T. _____ N. _____ S., R. _____ E. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 12-27, 19 79, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

C-12 Quarter Corner between Section's 31-32, set by Wells Burt, Deputy Surveyor in 1849.

Bearings were: W. Pine 5", S31°E, 28 lks. & W. Pine 7", N70°W, 12 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

C-12 Replaced corner from W. Pine B.T., S31°E, 28 lks; a stump cut high, scribe marks "1/4 S" intact; bottom blaze still evident. Found 26" W. Pine, West, 37.9' blazed and scribed by H. C. Lawrence, R.L.S. We have notes to indicate Mr. Lawrence was at this corner in 1938.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:


C-12 Placed 1" pipe with 4" aluminum cap at corner.

New Bearings: 13" Red Pine, N30°E, 59.0' & 11" Red Pine, N75°E, 72.8'. Remarkd 26" W. Pine, West, 37.9'.

SIGNED BY Billy D. Buckler

DATE 9-29-80

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

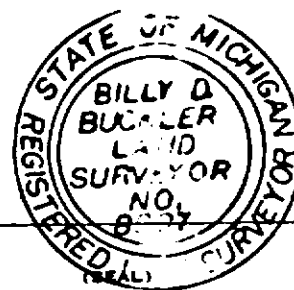

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971
REVISED MAY 14, 1978

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET