

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Chippewa Co.

Four Corners.

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>50</u> N. S., R. <u>5</u> K. W.	A-2 B-3 B-2 <u>3-Sec.6</u>
2. PROPERTY CONTROLLING IN SECTION <u>6</u>	T. <u>50</u> N. S., R. <u>5</u> K. W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. S., R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 6-16 & 6-17, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

NOTE: SEE SKETCH ON REVERSE SIDE

A. Description of original monument and accessories and/or subsequent restoration:

- A-2 Quarter Corner on West side, Sec. 6 was placed by Austin Burt, D.S. in 1849. Bearings were: Pine 10", N72°W 77 lks. and Pine 10", N67°E, 38 lks.
- B-3 Quarter corner bet. Sec's. 6 and 7, set by Austin Burt, D.S. in 1849. Bearings were: W. Pine 14", N61°E, 8 lks. and W. Pine 12", S45°E, 32 lks.
- B-2 Center Corner, Section 6, T50N. R5W.
- 3-Sec.6 North 1/16 Corner, on Westside, Sec. 6.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


- A-2 Corner re-established midway and on line bet. two Sec. Cors. Found no evidence of original witnesses. Corner lies on a Jackpine island surrounded by wetmarsh.
- B-3 Found a Concrete Monument with Brass Cap set by Chippewa County Surveyor. Distance checks well with a good corner, 1/2 mile West.
- B-2 Placed Center Corner at the intersection of lines connecting opposite 1/4 Corners.
- 3-Sec.6 Placed 1/16 Corner, midway bet. Sec. Cor. to North and 1/4 Cor. to South.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
Placed 1" pipe with 4" aluminium cap at all corners.

- A-2 New Bearings: 10" Jackpine, S72°E, 16.2' and 10" W. Pine, N20°E, 5.6'
- B-3 New Bearings: 12" W. Pine, N34°W, 82.6' and 8" Oak, N1°E, 51.5' and 10" Oak, N67°W, 13.0'
- B-2 New Bearings: 12" W. Pine, N68°E, 49.6' and 8" R. Pine, S63°W, 43.4'
- 3-Sec.6 New Bearings: 8" W. Pine, S49°E, 20.0' and 12" W. Pine, N5°E, 48.3'

SIGNED BY Billy D. Buckler DATE 8-25-75

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

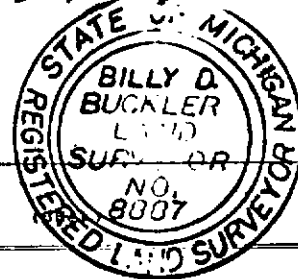

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____