

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Chippewa Co.

4 Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>50</u> N. <u>6</u> E. <u>6</u> S. <u>6</u> W.	D-11
2. PROPERTY CONTROLLING IN SECTION <u>31</u>	T. <u>50</u> N. <u>6</u> E. <u>6</u> S. <u>6</u> W.	5-Sec.31, 6-Sec.31 16-Sec.31
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ E. _____ S. _____ R. _____ W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 8-20 & 8-27, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:


- A. Description of original monument and accessories and/or subsequent restoration:
- D-11 Quarter Corner bet. Sec's. 29-32, set by Wells Burt, D.S. in 1849. Bearings were: Y. Pine 12", N23°W, 25.7' and S. Pine, 9", S9°E, 3.9'.
 - 16-Sec.31 East 1/16 Corner on South side of Section 31.
 - 5-Sec.31 North 1/16 Corner of Section 31.
 - 6-Sec.31 Northeast 1/16 Corner of Section 31.

- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- D-11 Replaced corner from remains of both witnesses, down and in poor condition.
 - 16-Sec.31 Placed corner midway bet. Sec. Cor. to East, and $\frac{1}{2}$ Cor. to West.
 - 5-Sec.31 Placed corner midway bet. North $\frac{1}{2}$ corner and Center of Section.
 - 6-Sec.31 Placed corner at center of Northeast $\frac{1}{2}$ Section.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
Placed 1" pipe with 4" aluminium cap at all corners. Bearings are:

- D-11 8" J. Pine, S73°W, 26.3' & 12" R. Pine, S23°E, 44.9' & 8" K. Pine, N39°E, 32.0'.
- 16-Sec.31 7" W. Pine, N34°W, 31.1' & 7" W. Pine, N32°E, 13.6'.
- 5-Sec.31 10" J. Pine, N29°W, 12.0' & 8" J. Pine, N8°E, 28.7' & 6" Oak, N55°E, 10.1'.
- 6-Sec.31 7" J. Pine, S31°W, 5.7' & 8" J. Pine, N8°E, 5.7' & 9" J. Pine, N57°W, 6.8'.
Corner lies 110' West of North and South road.

SIGNED BY Billy D. Buckler DATE 12-3-79
 Billy D. Buckler
 SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

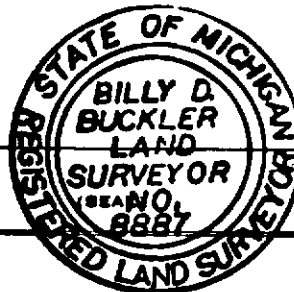

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY
 APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____