

Chippewa Co.

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970
Chippewa Co. 2 Corners

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 50 N. R. 6 E.	G-12 F-11
2. PROPERTY CONTROLLING IN SECTION	T. S. R. E. W.	
3. MISCELLANEOUS PROPERTY IN SECTION	T. S. R. E. W.	
4. LOT NO.	RECORDED PLAT	
5. PRIVATE CLAIMS		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 7-9-, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

G-12 Quarter Corner Bet. Sec's 33-34, set by Wells Burt, D.S. in 1849.
Bearings were: Spruce 10", S75°W, 32 lks. and S. Pine 12", N50°E, 10 lks.

F-11 Quarter Corner Bet. Sec's 28-33, set by Wells Burt, D.S. in 1849.
Bearings were: W. Pine 10", S71°E, 77 lks. and Y. Pine 12", N52°W, 75 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

G-12 Found 1/2" Iron set by R.L.S. # 20706. Position checks with corners on each end of mile.

F-11 Corner restored from original bearing tree stumps, marks visible on NW stump.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed 1" pipe with 4" aluminium cap at both corners.

G-12 New Bearings: 10" J. Pine, N23°W, 18.5' and 10" J. Pine, N75°W, 16.4' and 10" J. Pine, S4°E, 10.5'

F-11 New Bearings: 10" R. Pine, S42°W, 26.6' and 10" R. Pine, S57°E, 42.3' and 8" R. Pine, N71°E, 22.1'

SIGNED BY Billy D. Buckler DATE 9-10-79
Billy D. Buckler
SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

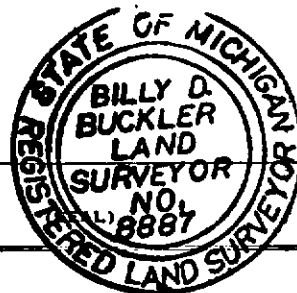

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY
APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____