

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

Chippewa Co.

Three Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 50 ^{N.} X. , R. 6 ^{W.} X.	G-3, G-4, G-5
2. PROPERTY CONTROLLING IN SECTION	, T. _____, S., R. _____, E. _____, W. _____	
3. MISCELLANEOUS PROPERTY IN SECTION	, T. _____, S., R. _____, E. _____, W. _____	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on 7-30, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corners set by Wells Burt, D.S. in 1849.

- G-3 Sec. Cor. 3-4-9-10. Bearings were: Spruce 6, S57°E, 18 lks. & Spruce 10, N47°W, 25 lks.
- G-4 $\frac{1}{4}$ Cor. bet. 9-10. Bearings were: Y. Pine 10, S3/4°W, 3.88 chs. & Y. Pine 14, S8&3/4°W, 3.63c'
- G-5 Sec. Cor. 9-10-15-16 " " S. Pine 10, N58°E, 48 lks & S. Pine 12, N59°W, 26 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- G-3 Re-established Sec. Cor. on line extended North thru the corners bet. Sec's 9 and 10; 15 and 16.
- G-4 Replaced corner form remains of both original witnesses pine stump S3/4°W has face and scribe marks "BT" in very good condition.
- G-5 Re-established corner by proportionate distance from corners $\frac{1}{2}$ mile North and $\frac{1}{2}$ mile South. Position checks with marsh edge and top of ridge. Found old blazes to South on the line.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Placed 1" pipe with 4" aluminium cap at all corners.

- G-3 New Bearings: 18" W. Pine, S31°W, 46.2' & 9" B. Spruce, S57°E, 11.9'
- G-4 Corner lies in North edge of a shallow pond.
New Bearings: 8" J. Pine, N43°E, 69.0' and 7" J. Pine, S1°W, 262.1' and 12" J. Pine, N15°W, 77.6'
- G-5 New Bearings: 14" J. Pine, N89°E, 35.6' and 12" J. Pine, N16°E, 29.7'


SIGNED BY Billy D. Buckler DATE 8-25-75

SURVEYOR'S MICHIGAN REGISTRATION NO. 8887

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

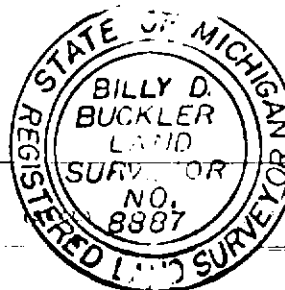

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____