

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A. 1970

Chippewa Co.

Three Corners.

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>50</u> N. <u>E.</u> R. <u>2</u> <u>E.</u> W.	M-3, M-4, M-5
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. _____ S. _____ R. _____ E. _____ W. _____	
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ S. _____ R. _____ E. _____ W. _____	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Billy D. Buckler do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on 10-1 1973, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on 19, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:
Corner set by Austin Burt, D.S. on July 14, 1840.

- M-3 Sec. Cor., 1-12, on East Boundary of Township.
Bearings were: N. Pine 8", S41°W, 36 lks. and N. Pine 7", N49°W, 27 lks.
- M-4 1/4 Cor. on East side, Sec. 12.
Bearings were: 12" Y. Pine, at corner and 14" Y. Pine, N80°W, 03 lks.
- M-5 Sec. Cor. 12-13, on East Boundary of township.
Bearings were: N. Pine 7", S20°W, 44 lks. and N. Pine 8", N22°W, 60 lks.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corners:

- M-3 Corner re-established on an old blazed line intersection, found a Y. Pine line tree, 6.15 chs. west; swamp edge, 7.50 chs. North. Position checks well with original corners, 1/2 mile to West and 1/2 mile to South.
- M-4 Corner replaced at remains of Y. Pine Stump. Found stump, cut low for the Bearing tree. Corner lies on top of high ridge.
- M-5 Corner replaced at an old wood post with remains of a B.T., S20°W, 44 lks.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
Placed 1" pine with 4" (aluminium) cap at all corners.
(or Brass)

- M-3 New Bearings: 18" Red Pine, S14°W, 59.7' and 6" Jack Pine, N29°W, 8.3'
- M-4 New Bearings: 8" Jack Pine, N34°W, 13.7' and 9" Jack Pine, S63°E, 23.3'
- M-5 New Bearings: 6" Jack Pine, N64°W, 32.5' and 6" Jack Pine, N10°E, 17.2'


SIGNED BY Billy D. Buckler DATE 10-2-73

SURVEYOR'S MICHIGAN REGISTRATION NO. 9587

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

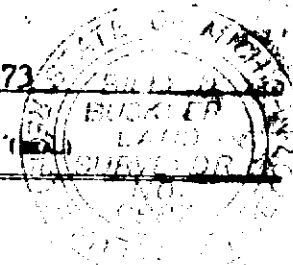

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____