

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 18 N. R. 06 W.	D-2, D-3, C-2
2. PROPERTY CONTROLLING IN SECTION	5, T. 18 N. R. 06 W.	9, 13
3. MISCELLANEOUS PROPERTY IN SECTION	T. S. R. E. W.	**334.15 S OF CODE 14
4. LOT NO.	, RECORDED PLAT	
5. PRIVATE CLAIMS		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, CARL F. ROSER, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on JANUARY 31, 1985, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

C. (CONTINUED)

13	*	C-2
FD 3/4" IR ROD W/RLS CAP; ADDED CED POST W/LOC TAG.	DROVE 5/8 X 30" IR ROD W/RLS CAP.	FD 3/4" PIPE; ADDED DNR MON & CED POST
3" MAPLE N30°W 27.4'	12" TAMARACK N30°W 28.1'	6" CEDAR N30°E 16.3'
3" MAPLE N20°E 14.5'	13" R OAK S40°W 21.2'	5" CEDAR N45°E 10.0'
3" MAPLE S80°E 8.5'	16" CEDAR DUE W 28.3'	6" CEDAR S60°E 31.8'
CTR TRAIL WLY DUE N 86'±2'	FD IR W/RLS CAP	7" CEDAR S55°W 20.6'
CTR TRAIL DUE E 115'±2'	& CONC VERT	
	CURB GUARD POST DUE W 32.9'	
	CTR N-S DIRT RD - DUE E 23'	

- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- D-2 ESTAB CTR OF SEC 5 AT INTERSEC OF 1/4 LINES. FITS RLS, MATT MCCLUNG. SEC SUB'N.
 - D-3 FD RLS, M MCCLUNG ROD AS ESTAB BY SINGLE PROPORTION; IN UNSTABLE MUCK SWP. ADDED DNR MON. (WELDED TO ST FN POST); OVER-ALL LTH IS 5 1/2'.
 - 9 FD & ACCEPTED 3/4" ROD BY RLS, M MCCLUNG FOR NE COR OF NW 1/4 OF SE 1/4 OF SEC 5.
 - 13 FD & ACCEPTED 3/4" ROD BY RLS, M. MCCLUNG FOR CTR OF SE 1/4 OF SEC 5.
 - ** ESTAB NE COR OF S 3/4 OF SE 1/4 OF SE 1/4 OF SEC 5 PER STD B.L.M. INSTRUCTIONS.
 - C-2 FD & ACCEPTED 3/4" PIPE BY RLS, MATT MCCLUNG FOR W 1/4 COR, SEC. 5.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

D-2	D-3	9
SET 5/8 X 34" REROD W/RLS CAP & CED POST W/LOC TAG.	FD 5/8" IR ROD IN 1 1/4" PIPE; ADDED DNR MON & CED POST.	FD 3/4" IR ROD W/RLS CAP & 4 1/2" TALL VERT CONC CURB FOR GUARD POST.
3" BALSAM N50°W 4.3'	2" MAPLE N20°W 8.2'	8" MAPLE N60°W 27.5'
6" W PINE N25°E 58.5'	8" CEDAR S35°E 15.3'	5" OAK N85°E 17.8'
2" BALSAM N60°E 6.9'	20" W PINE STP S50°W 26.2'	12" TW MAPLE S35°E 9.3'
FD FN POST IR & CED POST. N15°W 38.8'	7" CEDAR S60°W 13.6'	
	W'LY EDGE 16' WIDE CREEK. DUE E 130'	

SIGNED BY Carl F. Roser 01-06-86 DATE

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:


SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

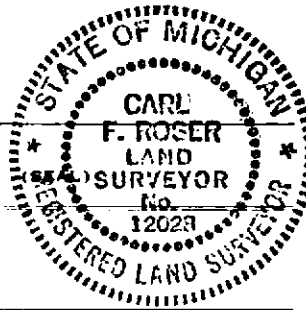

(SEAL)
FREEMAN TWP.
CLARE COUNTY