

**SURVEY & REMONUMENTATION COMMISSION**  
**APR 06 1995**

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

RECEIVED  
 E 10 A D  
 # 66-94  
 94 NOV 28 AM 10:36  
 REGISTER OF DEEDS  
 CLARE COUNTY  
 DONNA M. CARR

CLARE (County)	Located In:	Corner Code #
1. Public Land Survey	T 18N R 5W	L-7
	T R	
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, MARK R. ROBISON, in a field survey on OCTOBER, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**


- A. Description of original monument and accessories and/or subsequent restoration:  
 NOV. 1856 CANNON, POST (1)W. PINE 26" N22°W 29(19.14') (2)W. PINE 24" S37°E 39(25.74') G.L.O.  
 11-23-07 A.JOHNSON, GOVT. WITNESSES C.S.R.. 129-4  
 3- -66 LAPHAM, FOUND BROKEN TILE & O.B.T.'S UNRECORDED SURVEY  
 4-11-85 LAPHAM, UNRECORDED SURVEY  
 5-4-92 LAPHAM, FOUND CON. MON. (3)WEST 0.50' 8"x14" MARKER POST (4)N60°E 11.80' 10" MAPLE (5)N15°W 27.10' 27" TWIN MAPLE (6)S30°W 67.80' MAPLE CLUSTER L.C.R.C. 668

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:  
 TRAVERSED FROM K-7 N89°56'W, 2655.36' TO A CONCRETE MONUMENT AT L-7. FOUND REMAINS OF WITNESSES 1 & 2. IN A SURVEY DATED MARCH 1966, LAPHAM STATED THAT HE FOUND BROKEN TILE AND O.B.T.'S AND SET A CONCRETE MONUMENT. FOUND WITNESSES NOS. 3,4,5 AND 6. LEFT THE CONCRETE MONUMENT AS THE CLARE COUNTY REMONUMENTATION CORNER.

**APPROVED LAND CORNER**  
 P.A. 345 of 1990  
 Clare County  
 Chairman Paul S. Lyle  
 Date Nov. 23, 1994

This Corner established in Clare County Remonumentation Program.  
 See dossier for detailed report.

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
 FOUND AND LEFT A CON. MONUMENT 36"x4" WITH A 1/2" IRON ROD IN CENTER, CAPPED WITH A SURVEYOR CAP.  
 WITNESSES:  
 WEST, 0.05' - 8"x14" MARKER POST (3)  
 N60°E, 11.80' - 10" MAPLE (4) NAIL & TAG  
 N15°W, 27.10' - 27" TWIN MAPLE (5) NAIL & TAG  
 S30°W, 67.80' - MAPLE CLUSTER (6) NAIL & TAG

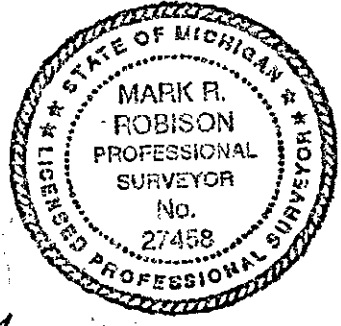

Signed by Mark R. Robison Date 11-23-94  
 Surveyor's Michigan License No. 27458