

MAR 24 2000

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970
Clare County Remonumentation

SECTION

For Corners in
Clare
 (County)

Located In: Corner Code#:

- 1. Public Land Survey T. 19N R. 6W I-13
 T. 18N R. 6W I-1
 T. _____ R. _____ I-_____
- 2. Public Controlling S. _____ T. _____ R. _____
 in Section S. _____ T. _____ R. _____
- 3. Miscellaneous S. _____ T. _____ R. _____
 Property in Section S. _____ T. _____ R. _____
- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

199900009774
 Filed for Record in
 CLARE COUNTY MICHIGAN
 CAROL MCAULAY
 On 11-10-1999 At 01:30 pm.
 LAND CORNER 9.00
 OR Liber 2 Page 53 - 53

Instrument Liber Page
 199900009774 OR 2 53

364-99

Register of Deeds Stamp & File Number

I, Mark R. Robison, in a field survey on August 11, 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

This is a single common corner to
 T19N, R6W, I-13 and T18N, R6W, I-1

A. Description of original monument and accessories and/or subsequent restoration:

1838 Rousseau
 Set Post Cor 34-35
 Pine 30" N80W 29
 Hemlock 10 N20E 41

10-01 Harper, CSR 1-08 & 4-09
 Cedar Stake
 N16E 27.1 24" W. Pine Stp.
 I-1 to G-1, 78.36

Circa 1900, CSR 6-251
 I-13 to H-13, 39.91
 1962 Lapham, CSR 6-35
 Little Norway Lake Subdivision

12-30-92 Erickson LCRC #738
 Fd C.I. 9433 in C.L. gravel rd int.
 S10E, 25.61 Nail in 8" Elm
 S42W 27.21 Nail in 15" Elm
 S76W 58.57 Nail in 15" Elm
 N59E 61.38 Nail in Cor. F. Post

8-24-06 & 1-23-07 Johnson
 CSR 4-66 & 4-81
 N54E, 50, 36" W. Pine
 I-1 to K-1 78.80

10-85 Lapham, CSR 16-48
 Lakeshore Subdivision

9-38 Unknown, CSR 2-105
 Stake Tile
 I-1 to H-1 39.75

8-16-90 Robison, CSR 611-189
 Fd 3/4" Iron
 N45E 61.43 F. Post
 S10E 25.8 6" Elm
 S15W 27.29 15" Elm
 S60W 58.57 15" Elm

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
 See dossier for detailed report.


Found C.I. Excavated to 3' and found no other material. Found all 1990 & 1992 witnesses. Corner falls in gravel road on a steep hillside w about 10 feet fill at C.L. Meas. East 2629.04 to J-13 and West 2615.70 to H-13. Meas. 996.5 (Rec 997.27) to P.O.B. Little Norway Lkae Subd.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 5/8" x 36" rered with Clare Co. Remon Cap marked P.S. #27458. Accepted as best available evidence of the accepted position of the corner.

Witnesses:
 N68°E, 61.50; Spike in Fence Cor. Post (OBT)
 S10°E, 25.61; Spike in 12" Elm (OBT)
 S42°W, 27.12; Spike in 18" Elm (OBT)
 S73°W, 58.63; Spike in 24" Elm (OBT)

Signed by Mark R. Robison
 Surveyor's Michigan License No. 27458

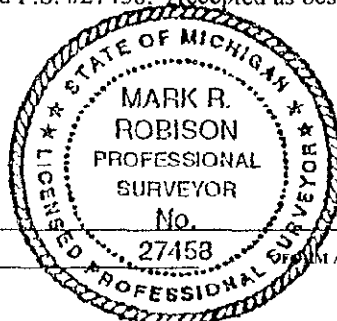

APPROVED LAND CORNER
 P.A. 345 of 1990

Clare County
 Chairman Carol A. McAulay

Date 9-29-99
 Date 11-8-99

APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 28,