

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY_____	T. <u>19</u> N. <u>6</u> W. <u>6</u>	F-5; F-6
2. PROPERTY CONTROLLING IN SECTION_____	T. _____ N. _____ S. _____ R. _____ E. _____ W. _____	
3. MISCELLANEOUS PROPERTY IN SECTION_____	T. _____ N. _____ S. _____ R. _____ E. _____ W. _____	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on February 8, 1985, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and or subsequent restoration:

- B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
- F-5** - Fd & accepted 2" x 5 1/2" pipe for N 1/4 corner, Section 16. This is a Schaaf mon.; fits 2 of his 1940 NBT stump remains. Schaaf notes indicate he had Coleman's 1856 (G.L.O.) dependent resurvey corner. Coleman's corner was estab. on line between Sec. cor W & original U.S.M.C. east (N86°47'E Coleman). This cor was used by J. Sedgman in sub'n. of Sec. 16. Corner fits G.L.O. tie to leave Swp. to west. No evidence of A. Johnson's corner.
- F-6** - Fd & accepted 1/2" rod by R.L.S., J. Sedgman for ctr. of Sec. 16; at intersection of 1/4 lines.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

F-5		F-6
<u>Fd old 2"x5 1/2" pipe, broke in two; added DNR mon &amp; ced post</u>		<u>Fd 1/2" iron rod w/RLS cap; added ced post w/loc tag</u>
* 6" Maple      N35°W      30.33'		10" Spruce      N30°W      10.27'
4" Ash          N80°E      31.72'		10" Spruce      N45°E      28.64'
*12" Ash        S30°E      25.43'		8" Spruce       S70°E      24.93'
*17" Black Oak S50°W      3.44'		6" Cherry       S40°E      17.02'

\*: J. Sedgman Wit.


SIGNED BY Carl F. Roser 01-06-86 DATE \_\_\_\_\_

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

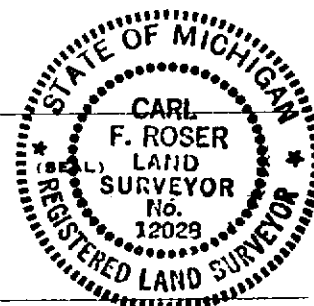

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_  
REDDING TWP  
CLARE COUNTY

Reproduced by the State of Michigan