

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. <u>19</u> N. <u>6</u> R. <u>6</u> W.	C-8; C-7
2. PROPERTY CONTROLLING IN SECTION	T. _____ N. _____ R. _____ W. _____	
3. MISCELLANEOUS PROPERTY IN SECTION	T. _____ N. _____ R. _____ W. _____	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on February 8, 1985, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- C-8 - Fd & accepted 2"x 39" pipe (Schaaf pipe) for E $\frac{1}{2}$ Cor., Section 19. Schaaf notes (Jan. 1940) indicate he had Coleman's 1856 dependent re-survey Tam. B.T. stp. (still evident). Fits Milton Nye's 1857 correction to Coleman's line 1/2 mile south of 35.02 chains to Nye's 1857 SE Section 19. Schaaf had 35.06 chains (35.083 this survey). Pipe fits Schaaf's 1940 NBTs.
- C-7 - Fd & accepted 2" pipe by Marcus Schaaf, Jan. 1940; best available evidence. Corner has been used by RLS, John Sedgman in sub'n of Sec. 19. Old E-W B-W fn is south 77'±. An old B-W fn cor (fn N&E) is 87'± South and 473'± West.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

	<u>C-8</u>		<u>C-7</u>
Fd old 2"x39" pipe; added DNR mon & cedar post		Fd old 2"x2' pipe rusted off; added DNR mon & cedar post	
9" Cedar S75°E	11.2'	*12" Maple N15°W	23.10'
9" Cedar S70°W	18.6'	*29" Red Pine S75E	95.5'
8" Cedar Due W	7.6'	*10" Balsam S50°E	19.06'
16" Cedar N65°W	28.6'	*34" White Pine N72°E	125.2'
		* 9" Maple S60°W	22.70'
		* - J. Sedgman Wit. * - M. Schaaf Wit.	

SIGNED BY Carl F. Roser 01-06-86 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

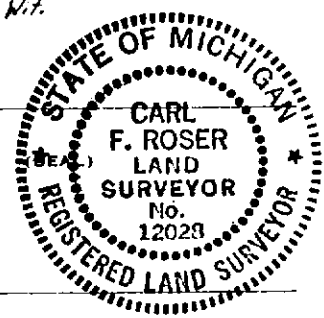

(SEAL)

REDDING TWP
CLARE COUNTY

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

Reproduced by the State of Michigan