

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 19 ^{N.} / _{S.} , R. 6 ^{E.} / _{W.}	C-11; D-9;
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ ^{N.} / _{S.} , R. _____ ^{E.} / _{W.}	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ ^{N.} / _{S.} , R. _____ ^{E.} / _{W.}	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on February 6, 1985, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

C-11 - Recovered 2" pipe that fits remains of 3 - M. Schaaf N.B.T. stumps. Schaaf (Conservation Department Forestry Chief & RLS - now deceased) notes, Aug. 1939, indicate U.S.B.T (stump) NE, B.T. stump hole SW & Hem L.T. site with bole on ground to south. Matt McClung, RLS & K. Don Fluke, RLS have used this corner. Also Paul Lapham, RLS.
D-9 - Fd and accepted old rusty 1 1/2" pipe by Marcus Schaaf for N 1/2 cor of Sec. 29. Schaaf's notes (Aug. 1939) indicate he had Milton Nye's April 1857 resurvey corner corrections to Francis Coleman's 1856 resurvey. Pipe fits Schaaf's NBTs very good.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

<u>C-11</u>			<u>D-9</u>		
Fd old 2" pipe added	DNR mon & ced post		Fd 1 1/2" pipe; added ced post w/loc tag		
10" Sugar Maple	N 5°E	7.04'	12" oak	N70°W	45.38'
8" Sugar maple	S40°E	18.6'	12" oak	N40°E	20.79'
8" Sugar maple	S15°E	9.75'	18" oak	S35°E	25.77'
16" Red oak	Due W	11.90'	5" oak	S60°W	24.83'
SEly edge Muskegon River	Due W	75'±4'	N.S. dirt tr.	East	94'
			Top bluff	Due E	113'

SIGNED BY Carl F. Roser 01-06-86 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

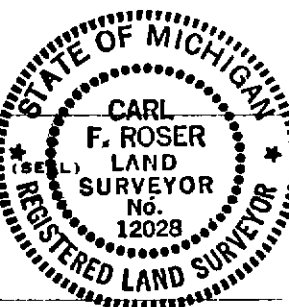

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

REDDING TWP.
CLARE COUNTY

Reproduced by the State of Michigan