

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. <u>19</u> N. <u>6</u> R. <u>6</u> W.	<u>F-9; E-7;</u>
2. PROPERTY CONTROLLING IN SECTION	T. _____ N. _____ R. _____ W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION	T. _____ N. _____ R. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on February 5, 1985, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- F-9 - Restored S $\frac{1}{4}$  Cor. of Sec. 21 from Schaaf wits. (Apr. 1940). Schaaf notes indicate he had B.T. remains of both the 1856 resurvey corner and the old original corner; 86 links N & 21 links E (defaced) of resurvey cor. This cor. (this survey) is a restoration of Schaaf's which is a restoration of Coleman's 1856 resurvey. Fits U.S. tie to small round swamp 1-ch. to West. Old fn corner remains (fn E&S) is 166' S & 30' W
- E-7 - Fd & accepted M. Schaaf pipe for NW Cor. of Sec. 21. Schaaf notes (1940) indicate he had Gov't. Cor.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

	F-9		E-7		
Set DNR mon, broken			Fd old 2" pipe; added		
6" Maple	N5°E	7.0'	w/loc tag		
8" Black Cherry	S65°E	25.8'	14" Maple	N50°E	12.5'
3" Maple	S15°E	38.6'	16" Black Cherry	S20°E	18.9'
8" Maple	S65°W	9.1'	9" Maple	S40°W	21.7'
Ctr E-W trail	Due S	54'	6"x60" pipe w/conc		
			gate post	Due E	19.9'
			Ctr N-S trail	Due E	27'

SIGNED BY Carl F. Roser 01-06-86 DATE \_\_\_\_\_

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

MICHIGAN REGISTERED LAND SURVEYOR

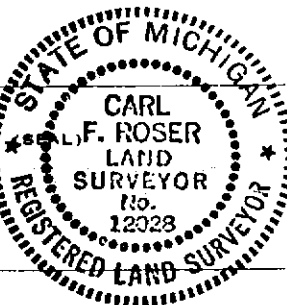

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_ REDDING TWP  
CLARE COUNTY

Reproduced by the State of Michigan