

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 19 N. R. 6 W.	G-10; G-11;
2. PROPERTY CONTROLLING IN SECTION 28	T. 19 N. R. 6 W.	3
3. MISCELLANEOUS PROPERTY IN SECTION	T. N. R. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on February 6, 1985, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

C - Continued

~~At this location no original monument or subsequent restoration~~

3

Set 5/8" x 34" re-rod w/RLS cap & ced post w/loc tag

3" B oak	N70°W	7.3'
4" R oak	N25°E	5.0'
6" Maple	Due E	12.0'
fd old 2" pipe	N2°35'E	16.35'

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

G-10 - Fd and accepted 3/4" rod by RLS, M. McClung for E 1/4 cor of Sec. 28. Corner is in line with ced posts easterly.

G-11 - Fd and accepted 3/4" Ir by RLS, M. McClung for SE cor of Sec. 28.

3 - Established N1/8 corner on Sec. line common to Secs 28 & 29 mid-way & on line between NW & W 1/2 cors of Sec. 28 (recovered Schaaf Cors). A Schaaf pipe - set in error in 1940 - for 1/8 Cor is N02°36'E, 16.35', being a 2" pipe which we drove flush with ground and left in place.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

<u>G-10</u>	<u>G-11</u>
Fd 3/4" iron rod w/RLS cap	Fd 3/4" iron rod w/RLS cap
3" W Pine N50°W 57.83'	Guy pole N40°W 60.11'
6" B oak N80°W 45.50'	Power pole N35°E 58.65'
Power pole N85°E 22.84'	ctr N-S gr Due W 5'
Set ced post Due W 33'	rd
w/loc tag	ctr gr rd E Due N 7'
ctr N-S gr rd Due W 6'	set ced post Due W 45'
	w/loc tag

SIGNED BY Carl F. Roser 01-06-86 DATE \_\_\_\_\_

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_

MICHIGAN REGISTERED LAND SURVEYOR

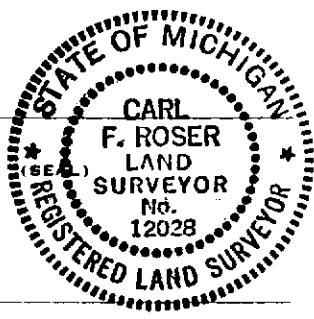

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_

REDDING TWP.  
CLARE COUNTY

Reproduced by the State of Michigan