

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____ T. _____ N. _____ K. _____ S. _____ R. _____ W. _____		
2. PROPERTY CONTROLLING IN SECTION <u>22</u> T. <u>19</u> N. <u>6</u> K. _____ S. _____ R. _____ W. _____		<u>13;16</u>
3. MISCELLANEOUS PROPERTY IN SECTION _____ T. _____ N. _____ E. _____ S. _____ R. _____ W. _____		
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on February 25, 1985, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

<p style="text-align: center;"><u>13</u></p> <p>Estab. ctr of SE$\frac{1}{4}$ of Sec. 22 per Std B.L.M. instructions. Corner falls in tag alder willow swamp in 4" of standing water. A 6' wd creek is 495'± south</p>	<p style="text-align: center;"><u>16</u></p> <p>Estab. SE corner of SW$\frac{1}{4}$ of SE$\frac{1}{4}$ of Sec. 22 per Std B.L.M. instructions. Corner falls in approx. ctr. of E-W dirt road.</p>
---	---

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

<p style="text-align: center;"><u>13</u></p> <p>Set 1$\frac{1}{2}$" x 50" pipe w/RLS cap & ced post w/loc tag</p> <table style="width: 100%; border: none;"> <tr> <td>9" B Ash</td> <td>N70°W</td> <td>34.8'</td> </tr> <tr> <td>4" B Ash</td> <td>N10°E</td> <td>30.2'</td> </tr> <tr> <td>5" B Ash</td> <td>S70°E</td> <td>35.5</td> </tr> </table>	9" B Ash	N70°W	34.8'	4" B Ash	N10°E	30.2'	5" B Ash	S70°E	35.5	<p style="text-align: center;"><u>16</u></p> <p>Drove 5/8" x 34" re-rod w/RLS cap</p> <table style="width: 100%; border: none;"> <tr> <td>11" tamarack</td> <td>N35°W</td> <td>50.00'</td> </tr> <tr> <td>9" cedar</td> <td>N5°E</td> <td>34.06'</td> </tr> <tr> <td>8" cedar</td> <td>N35°E</td> <td>49.85'</td> </tr> <tr> <td>set ced post w/loc tag</td> <td>Due N</td> <td>33'</td> </tr> </table>	11" tamarack	N35°W	50.00'	9" cedar	N5°E	34.06'	8" cedar	N35°E	49.85'	set ced post w/loc tag	Due N	33'
9" B Ash	N70°W	34.8'																				
4" B Ash	N10°E	30.2'																				
5" B Ash	S70°E	35.5																				
11" tamarack	N35°W	50.00'																				
9" cedar	N5°E	34.06'																				
8" cedar	N35°E	49.85'																				
set ced post w/loc tag	Due N	33'																				


SIGNED BY Carl F. Roser 01-06-86 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

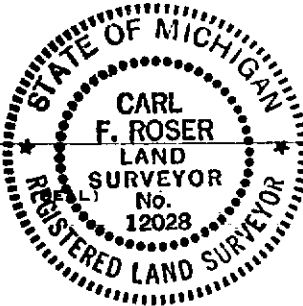

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ REDDING TWP
CLARE COUNTY

Reproduced by the State of Michigan