

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. PA 1970

For Corners In:
Clare Located In _____ Corner Code # _____
 (County)


- | | | | | |
|--------------------------------------|---------|--------------|-------------|------------|
| 1. Public Land Survey | | T <u>19N</u> | R <u>6W</u> | J <u>5</u> |
| | | T _____ | R _____ | _____ |
| 2. Property Controlling in Section | S _____ | T _____ | R _____ | _____ |
| | S _____ | T _____ | R _____ | _____ |
| 3. Miscellaneous Property in Section | S _____ | T _____ | R _____ | _____ |
| | S _____ | T _____ | R _____ | _____ |

4. Lot No: _____ Recorded Plat: _____

5. Private Claims: _____

I, Craig W. McVean, in a field survey on Oct. 22, 2008 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

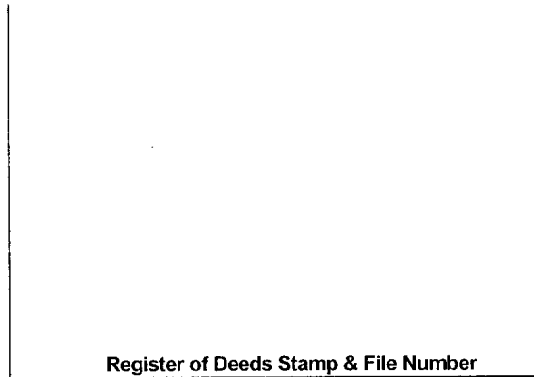

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5									●				
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

- J5 – **1856** – GLO – F. Coleman
 Set ¼ Sec. Post
 1) W. Pine 20" N30°E 22 L.
 2) W. Pine 16" S58°W 63 L.
 - **1992** -- Unrecorded Survey – Gourdie-Fraser & Assoc. – File # 920128 – G. G. Wilson – Iron set

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- J5 – ¼ Corner common to Sec. 11 & 14 – No GLO evidence found. Fd. ½" x 18" capped iron rebar #21568 – 25875 per Wilson. Corner of fences S & E is N69°E 23.6'. Measured the following grid bearing and distances from ½" CIR; S89°51'55"E 2660.84' (2621.19' – GLO) to 'K5' and N89°52'48"W 2660.46' (2621.19' – GLO, 2659.85' – GGW) to 'I-5'. ½" CIR accepted as a careful & faithful reestablishment of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- J5 – Replaced ½" x 18" CIR w/ stamped 4" DNR Alum. Cap on 1" x 36" Galv. iron pipe.
 Set Blue Carsonite Post 1' SW
 N45°W 27.61' to fd. nail in SW side 18" Oak
 N47°E 18.02' to set N & T at fd. nail in SE side 14" Tw. R. Maple
 S12°E 45.00' to set N & T in W. side 7" Oak
 S50°W 49.92' to set N & T in SE side 3" R. Maple scribed 'XBT'



Signed by: Craig W. McVean
 Surveyor's Michigan License No.: 39088

Date: 5/26/2009