

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. PA 1970
REMONUMENTATION

For Corners In:
 Clare _____ Located In _____ Corner Code # _____
 (County)


1. Public Land Survey T 19N R 6W #2
 T _____ R _____

2. Property Controlling in Section S _____ T _____ R _____
 S _____ T _____ R _____

3. Miscellaneous Property in Section S _____ T _____ R _____
 S _____ T _____ R _____

4. Lot No: _____ Recorded Plat: _____

5. Private Claims: _____

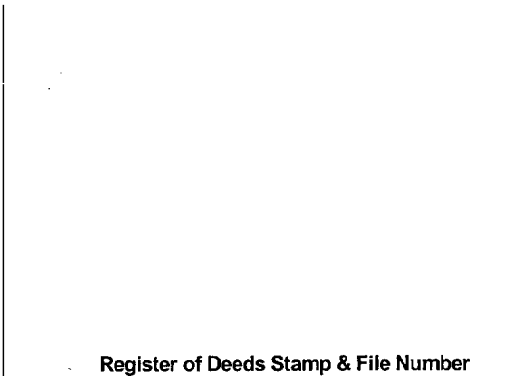

I, Craig W. McVean, in a field survey on March 5, 2008 do hereby state that under requirements of PA 74, Michigan PA of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

#2 (MC-36) – 1856 – GLO Resurvey – F. Coleman – West 16.59 between Sec. 9 & 16
 - Old Meander Corner remarked
 1) Maple 6" S75°E 54 L.
 2) W. Ash 12" N15°E 74 L.
 20.10 over river
 21.04 old Meander Corner (MC-19)

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

#2 (MC-36) – Meander Corner per GLO plat on left bank of Muskegon River between Sec. 9 & 16 – No evidence of GLO post or BT's.
 Set stamped 2" Alum. Cap on 5/8" x 34" rebar by single proportion between 'G5' and Meander Corner 'MC-19' on Right bank of river. Measured the grid distance and bearings from 'MC-36' as follows: S89°14'45"E 1096.76' (1094.94' – GLO) to 'G5' and N89°14'45"W 294.19' (293.7' – GLO) to 'MC-19'. Edge of River is 9' West. 2" Alum. Cap is accepted as a careful and faithful re-establishment of the position of the original corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

#2 (MC-36) – Stamped 2" Aluminum Cap on 5/8" x 34" rebar
 N30°E 21.59' to set Nail and Tag (N & T) in E. side 12" R. Maple scribed 'XBT'
 S72°E 55.09' to set N & T in S. side 36" R. Maple scribed 'XBT'
 N48°W 34.42' to set N & T in NE side 16" Elm scribed 'XBT'
 N75°E 99.11' to set N & T in SE side 10" R. Maple scribed 'XBT'
 S47°55'E 55.89' to Fd. 1/2" CIR # 45505
 Set Blue Carsonite Post with Loc. Tag 1' S
 N89°14.45"W 294.19' (293.7' – GLO) to MC-19 (2" Aluminum Cap on Right Bank of River)



Signed by: Craig W. McVean
 Surveyor's Michigan License No.: 39088

Date: 10/20/2008