

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

<u>CLARE</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>19N</u> R <u>4W</u>	<u>1-7</u>
	T ___ R ___	___
	T ___ R ___	___
	T ___ R ___	___
2. Property Controlling in Section	S ___ T ___ R ___	___
	S ___ T ___ R ___	___
3. Miscellaneous Property in Sec.	S ___ T ___ R ___	___
	S ___ T ___ R ___	___

REC'D
 E.V.
 #157-96
 95 NOV 14 PM 4:10
 REGISTER OF DEEDS
 CLARE COUNTY
 DONNA M. CARR
 Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
 5. Private Claims _____

I, MARK R. ROBISON, in a field survey on AUGUST, 1996 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7									⊙				
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
- 1857 ADAIR
WIT.-SET POST
W. PINE 14" S22°E 114 LKS.
S. PINE 15" S07°W 115 LKS.
 - UNDATED UNKNOWN, C.S.R. L.5, PG. 238
WIT.- W. PINE 15" S7°E 115 LKS.
I-7 TO J-7 = 39.36'
 - 9-27-84 LAPHAM
WIT.-FOUND CAPPED IRON IN @ E-W ROAD.
& 3' WEST OF NORTH ROAD.
S45°E, 72.15' - 14" NORWAY PINE.
S10°E, 81.80' - 10" POPLAR.
S40°W, 91.90' - 10" OAK.
 - 07-09-56 MOORE, C.S.R. L.3, PG. 46
WIT.-IRON
S44°W, 83.5' - 8" OAK.
S19°E, 72.7' - 12" NORWAY
I-7 TO J-7 2630 FEET.
 - 8-23-74 McCLUNG
WIT.-FOUND ROD/ID CAP
N25°E, 78.8' - UTIL. POLE.
S50°E, 93.8' - 20" N. PINE.
 - 1-11-95 GRAY
WIT.-FOUND CAPPED ROD.
N34°W, 326' AZ, 70.79' 4" TAMARACK
S22°E, 158' AZ, 73.14' 16" NORWAY PINE.
S38°W, 218' AZ, 83.16' 12" RED OAK.
S47°E, 133' AZ, 91.11' 16" NORWAY PINE.
 - 12-22-58 MOORE, C.S.R. L.3, PG. 99
WIT.-SAME AS 07-09-56

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

FOUND MONUMENT BOX WITH 1/2"x7" IRON & CAP OVER OLD AXEL SHAFT AND HUB. FOUND 1956 WITNESSES & OTHER OLD WITNESSES AS NOTED BELOW. MEASURED 2633.7' (REC. 2630 FEET) I-7 TO H-7.

See dossier for detailed report.


C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

SET 5/8"x36" RE-ROD WITH 3" CLARE COUNTY MONUMENT CAP.
 ACCEPTED AS BEST AVAILABLE EVIDENCE OF THE ACCEPTED POSITION OF THE CORNER.

WITNESSES:
 S62°E, 93.8' - NAIL & TAG IN 20" N. PINE (OBT).
 S22°E, 73.14' - NAIL & TAG IN 18" N. PINE (OBT).
 S38°W, 83.16' - NAIL & TAG IN 16" R. OAK (OBT).
 S40°W, 91.9' - NAIL & TAG IN 10" OAK (OBT).
 S47°E, 91.11' - NAIL & TAG IN 18" N. PINE.

APPROVED LAND CORNER
 P.A. 345 of 1980
 Clare County
 Chairman Paul D. Leph
 Date 11-07-96

Signed by Mark R. Robison
 Surveyor's Michigan License No. 27458

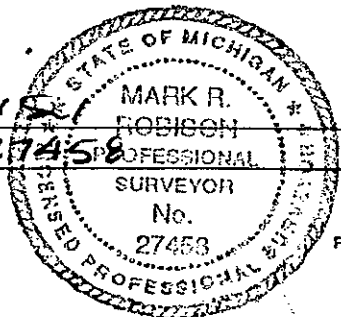

Date 9-23-96