

**SURVEY &
REMONUMENTATION**

MAR 24 2000

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970
Clare County Remonumentation

SECTION

For Corners in
Clare

(County)	Located In:	Corner Code#:
1. Public Land Survey	T. <u>20N</u> R. <u>3W</u>	<u>E-9</u>
	T. _____ R. _____	_____
	T. _____ R. _____	_____
2. Public Controlling in Section	S. _____ T. _____ R. _____	_____
	S. _____ T. _____ R. _____	_____
3. Miscellaneous Property in Section	S. _____ T. _____ R. _____	_____
	S. _____ T. _____ R. _____	_____
4. Lot No. _____, Recorded Plat _____		
5. Private Claims _____		

199900007858
Filed for Record in
CLARE COUNTY MICHIGAN
CAROL MCAULAY
On 09-20-1999 At 11:15 am.
LAND CORNER 9.00
DR Liber 2 Page 22 ~ 22

Instrument Liber Page
199900007858 DR 2 22

Register of Deeds Stamp & File Number

I, Mark R. Robison, in a field survey on July 22, 1999, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1856 Adair
Set Post Cor Sec. 20, 21, 28 & 29
W. Pine 36 N75E 18 Lks.
Beech 8 S64W 37

1916 Johnson, CSR 2-40
W. Pine 36 N75E 18 Lks. (Gov't)
W. Pine 36 S53 Lks.
Meas. East 40.34

1979 Lapham LCRC #364
Same witnesses as (132) 2-459

1979 Lapham (132) 2-459
Fd 1/2" Pipe
S10E 55.1 24" Maple
North 33.00 1/2" Iron
N45E 80.3 P.P.
Meas. N00-45-14W 5283.65 to Sec. Cor

1995 Gray LCRC #799
Fd 1/2" Pipe
S12E 63.70 22" R. Maple
S11W 30.84 2" R. Oak
S42W 31.54 2" R. Oak
N68E 89.29 Service Pole

APPROVED LAND CORNER
P.A. 345 of 1990
Clare County

Chairman Mark R. Robison
Date 9-15-99

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


See dossier for detailed report.

Found 1/2" x 18" pipe over grader blade at 18" depth. Found one 1979 witness and four 1995 witnesses. Meas. West 5339.10 feet to C-9. Meas. East 2644.29 to F-9.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Set 5/8" x 36" rebar with Clare Co. Remon Cap marked P.S. #27458. Accepted as best available evidence of the accepted position of the corner.

Witnesses:
N68°E 89.35; Fd N & T in P.P. (OBT)
S20°E 63.80; Fd N & T in N.W. Root 38" Maple (OBT)
S11°W 30.89; Fd N & T in 6" Oak (OBT)
S42°W 31.54; Fd N & T in 3" Oak (OBT)
North 33.35; Fd 1/2" Iron

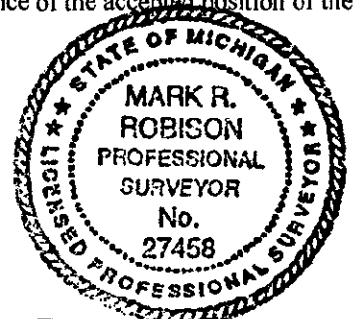

Signed by Mark R. Robison
Surveyor's Michigan License No. 27458

Date 9-15-99