

DEC 07 1994

COMMISSION

CENTER OF SECTION 24, VICTOR TWP.

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

For corners in
Clinton
(County)

Located in:

Corner Code -#

- 1. Public Land Survey T 6N R 1W L-8
- T _____ R _____
- T _____ R _____
- T _____ R _____
- 2. Property Controlling S _____ T _____ R _____
- In Section S _____ T _____ R _____
- 3. Miscellaneous S _____ T _____ R _____
- Property in Sec. S _____ T _____ R _____

DEC 5 3 17 PM '94

REGISTER OF DEEDS
CLINTON COUNTY, MICH.
Carol Atwater

LIBER 4, PAGE 28

Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2													
3													
4													
5													
6													
7													
8													
9													
10													
11													
12													
13													

Arden S. Pierson PS, in a field survey on October 10, 1994, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
L-8 - This position not established by original government surveyors.
John Sellek, PS #2585, in act 74 LCRC filed in Liber 2, page 429. "Field book #1 - October 17, 1977 in Alward Road, 1/2 mile West of Meridian Road, Found 1/2" pipe with pinched top - Section 4" long broken off & next to base section, 6" below gravel surface of road" With Witnesses:

*(OVER)

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Section 24, Victor Township

L-8 - Found RR spike (10-19-93) in top of pipe - buried 18". Accepted spike in pipe as the best available evidence of the position of this corner. Replaced spike in pipe (12-02-94) with Standard Clinton County Monument and monument box.

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

L-8 (Center of Section 24)
Clinton County Monument

Nail & Stephen's tag in S. side 18" Hickory -N80°E- 96.40'
Face angle iron anchor post -S05°W- 26.67'
Nail & tag #13039 NE side telephone pole -S37°E- 38.33'
Nail & tag #13039 E. side 30" Hickory -N11°W- 31.38'


*Standard Clinton County Monument is a 2 1/4" dia. steel tube 30" long with a stamped brass cap and breakaway magnetic base.

Signed by Arden S. Pierson
Surveyor's Michigan License No. 13039

December 3, 1994

APPROVED BY
CLINTON COUNTY PEER GROUP
DATED 11-3-94

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 24, 1978
REVISED MAY 14, 1979
REVISED 2001, 1982

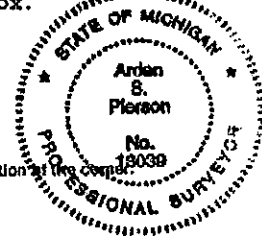

TO: 517 373 0464 DEC 5, 1994 4:06PM #337 P.03

FROM: CLINTON COUNTY

CENTER OF SECTION 24, VICTOR TOWNSHIP

LCRC by John Sellek

"Put down 1" pipe & cap over existing 1/2" pipe"

Nail & brass washer in 24" Hickory -N11°W- 30.80'

Nail & brass washer in 18" Hickory -N75°E- 95.65'

2 1/4" angle iron corner post braced to S&W -S03°W- 26.90'

1/2" pipe with pinched top -S03°W- 32.50'

SURVEY &
REMONUMENTATION

DEC 07 1994

COMMISSION