

SEP 2 0 1999

SECTION

REMONUMENTATION LAND CORNER RECORDATION CERTIFICATE Filing Requirement of Act 74, Mich. P.A. 1970

Victor Township

RECORDED

For corners in	•	
Clinton	Located in:	Corner Code #
(County)		
1. Public Land Survey	T <u>6N</u> R_1W TR	M-6
	T R TR	
2. Property Controlling in Section	STR STR	
3. Miscellaneous Property in Sec.	STR STR	


. Recorded Plat

Dec 3 8 15 AM '96

RECHE MEETES CHIEF. Care : Holly.

LIBER 4, PAGE 189

Register of Deeds Stamp & File Number

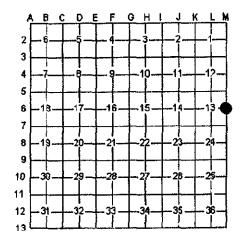

I. Mark L. VanRaemdonck, in a field survey on July 22, 1996, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the current points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, remonumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
- 1.) Original

4. Lot No. 5. Private Claims

nai Monument: Wood post Tam, 4 N57W 12% 3 S57W 21

2.) Hathaway J. Hanes, survey recorded L. 1, p. 472, 7/30/74

Monument: #6 reiron PK nails

Accessories: 24" Oak N35W 123.9"
10" Aspen N40E 58.5
16" Maple S30W 172. 58.50*

S30W 172.0°

3.) Hathaway J. Hanes, L.C.R.C. recorded L. 1, p. 809, 9/3/74 Monument: Set #6 re-iron

Accessories:

E. side 24" Oak N35W 123.9' W. side 10" Aspen N40E 58.50' E. side 16" Maple S30W 172.0' 58.50 PK spikes

4.) Maurice H. Mahleu, L.C.R.C. recorded L. 2, p. 533 11/5/84

Monument: #6 rerod Accessories:

Nail & tag in E. side 10" Elm N40W

84.55

N25W Nail & tag in E. side 20" Oak

123.89

N20E Nail & tag in E. side util. pole

149.76

98.42

Nail & tag in W. side 18" Poplar N30E

5.) Maurice H. Mahieu, survey recorded L. 2, p. 743, 11/5/84

Monument: Found 5/8" rerod
Accessories: 10" EIM

N40W

20" Oak N25W N₂0E 149.76

util. pole 18" Poplar N3DE

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 5/8" rerod as referenced in No. 2, 3, 4 and 5 above. Found no conflicting evidence. Excavation to install standard marker revealed no further evidence. Accepted this location as the original corner position based on the best available evidence.

C. Description of monument for corner and accessories to perpetuate locating the position of the corner:

DATED

Removed 5/8" rerod and replaced it with a standard Clinton County Monument and mon box. The monument is stamped "24622" and is witnessed by the following accessories:

7/17/96

N15°E 50.00'

Set R&C 24622 in E. shoulder Set R&C 24622 in W. shoulder

50.00

S15°W 50.00 Set R&C 24622 in E. shoulder Set R&C 24622 in W. shoulder

Surveyor's Michigan License No. 24622

APPROVED BY CLINTON COUNTY PEER GRE

OF MICALCA FORM APPRENED BY MICHIGAT THE BOARD CH

PROFESSIONAL REVISED JAN. 1883

BURVEYOR

NO.

24622

OPESSIONAL REVISED JAN. 1883

OPESSIONAL REVISED JAN. 1883