

MAR 29 2000

SECTION

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

STATE OF MICHIGAN  
CRAWFORD COUNTY  
RECORDED

17 AUG 99 12:34 P.M.

SANDRA MOORE  
REGISTER OF DEEDS

Register of Deeds Stamp & File Number

For corners in

Crawford

(County)

Located In:

Corner Code #

1. Public Land Survey	T <u>25N</u> R <u>4W</u>	<u>C-9</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

LIBER 4 PAGE 32

I, Marvin E. Myers, in a field survey on Dec 29, 1998, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

G.L.O - 1852 Addison P. Brewer, DS Mon. - Set Post Wit: 8" S. Pine N62°W 19 lks. 6" S. Pine S28°E 11 lks.	L. 192, P. 499 & 500 June 16, 1980 Mon - Fd. 2" Pipe 1.5 deep Placed 1/2"x18" bar & cap in center Wit: None given	L. 234, P. 509 April 1985 M. MacDonald # 22438 Mon - Fd. Capped 1/2" Iron Wit: N. 2' to centerline of Road 10" Pine SW 43.6 tag in 12" Pine SE 55.3
--	--	---

1930's M. Schaaf  
Mon - Iron (sunk)

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Found 1/2"x18" bar inside 2" pipe with concrete base (typical Schaaf); found 12" Pine (dead) SE 55.3. Accepted 1/2" bar as the best available evidence of the Position of the Original Corner. Replaced 1/2" bar with Standard Crawford County Monument over top of 2" pipe left in place inside pavement monument box.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Mon - Set Standard Crawford County Monument in pavement monument box.

Wit: Nail NE side 11" Norway S27°E 87.40  
Nail NW side 4" J. Pine S45°W 72.59  
Nail NE side 6" J. Pine N38°W 52.88  
Nail E. side 7" J. Pine N10°E 40.43  
Nail SE side 6" J. Pine N73°E 78.66  
Centerline of Road South is East 4'±  
Centerline of Road North is West 82'±  
Corner is 2'± North of E-W Road Centerline  
Carsonite post North 32'±

CRAWFORD COUNTY  
PEER GROUP APPROVAL

DATE June 7, 1999


*Marvin E. Myers*

Marvin E. Myers, P.S.  
County Surveyor

Signed by

*Marvin E. Myers*

Surveyor's Michigan License No. 31600

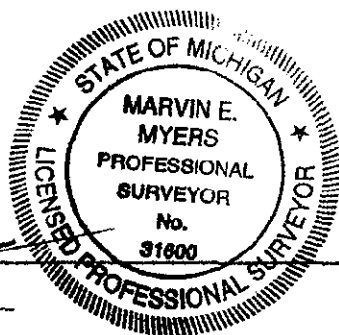

Date June 9, 1999