

# LAND CORNER RECORDATION CERTIFICATE

## FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 27 N. R. 4 W.	(A-7), (C-6), (C-7)
2. PROPERTY CONTROLLING IN SECTION 18	T. 27 N. R. 4 W.	13
3. MISCELLANEOUS PROPERTY IN SECTION	T. S. R. E. W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Kenneth J. Ostling, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on March 7, 1979, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on \_\_\_\_\_, 19\_\_\_\_, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument and accessories and/or subsequent re-creation:~~

C. (continued)

13  
Set 5/8" Rod w/RLS Cap  
and Cedar Post  
3" Spruce S10°W 14.90  
12" R. Pine S89°W 45.38

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


- A-7 (A) Restored from U.S.B.T. stumps by M. Schaaf in 1940's. Recovered & replaced under direction of D. C. DeLaMater in 1951; rewitnessed. (B) Rewitnessed previous Department corner for recording.
- C-6 Recovered corner as restored in 1957 survey from U.S.B.T. stump. Rewitnessed for proper recording. See DNR corner record for more information.
- C-7 Corner in place as set in 1957 survey of Sec. 19 T27-4W. Rewitnessed for recording.
- 13 Set corner by standard survey procedure for the subdivision of sections.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-7	C-6	C-7
DNR Mon. & Cedar Post in Place (Old wit.) 1951 -	DNR Monument in Place	Fd. DNR Monument & Cedar Post in Place
10" J.Pine S09°W 22.77	*4" Spruce S81°E 10.9	*11" W. Birch S38°E 43.55
7" J.Pine N35°E 44.03	5" Spruce S24°W 17.64	*12" W. Birch N57°E 45.45
	*1957 witness	* 1957 Witnesses

SIGNED BY Kenneth J. Ostling  
 SURVEYOR'S MICHIGAN REGISTRATION NO. 10068

DATE 5/16/79

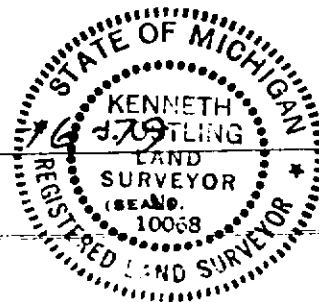

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY \_\_\_\_\_ DATE \_\_\_\_\_  
MICHIGAN REGISTERED LAND SURVEYOR

SURVEYOR'S MICHIGAN REGISTRATION NO. \_\_\_\_\_ CRAWFORD COUNTY