

MAR 29 2000

SECTION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970
Also Act 345, PA 1990

STATE OF MICHIGAN
CRAWFORD COUNTY
RECORDED

28 DEC 99 3:01 P.M.

SANDRA MOORE
REGISTER OF DEEDS

For corners in

<u>Crawford</u> (County)	Located In:	Corner Code #
1. Public Land Survey	T <u>28N</u> R <u>1W</u>	<u>E-13</u>
	T <u>27N</u> R <u>1W</u>	<u>E-1</u>
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

LIBER 4 PAGE 70

I, James L. Schwandt, in a field survey on May 14, 1999, do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6		5		4		3		2		1	
3												
4	7		8		9		10		11		12	
5												
6	18		17		16		15		14		13	
7												
8	19		20		21		22		23		24	
9												
10	30		29		28		27		26		25	
11												
12	31		32		33		34		35		36	
13												

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

- 1.) Post set by James Mullett, D.S. in 1839
Pine 4", N39°E, 1.01'
Pine 3", N70°W, 1.05'
- 2.) Carlos Laguire (date unknown)
Random from Delamaters corner which later proved good
- 2.) 1994, Donald Marlatt
Found 1/2" rod
North 31.70', spike in p. pole
S40°E, 46.15' spike in 8" J. Pine

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


- Found 1/2" rod with P.K. nail riser 41.5' East of road intersection
- Found spike in cut off p.pole North 31.70'
- Found spike in 8" J. Pine, S40°E, 46.15'
- Found spike in PP, S16°W, 31.38'

CRAWFORD COUNTY
PEER GROUP APPROVAL
DATE June 7, 1999

Marvin E. Myers
Marvin E. Myers, P.S.
County Surveyor

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- Set Crawford County Monument 41.5' East of road intersection and is accepted as a careful and faithful perpetuation of the position of the original corner.
- Spike in cut off P.Pole North 31.70'
- Spike in 8" J. Pine, S40°E, 46.15'
- Spike in PP, S16°W, 31.38'
- Spike 6" J. Pine, N20°E, 46.25'

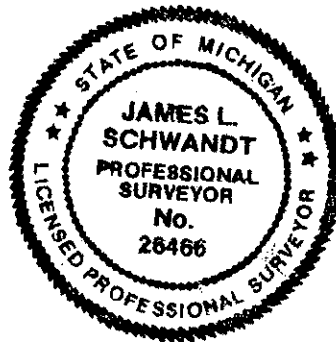

Signed by James L. Schwandt

Date 12-10-99

Surveyor's Michigan License No. 26466