

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

Crawford
 (County)

Located In:

Corner Code #

STATE OF MICHIGAN
 CRAWFORD COUNTY
 RECORDED

5 JAN 98 10:36 A.M.

SANDRA MOORE
 REGISTER OF DEEDS

1. Public Land Survey

T28N R4W

K-10

T___ R___

T___ R___

T___ R___

2. Property Controlling in Section

S___ T___ R___

S___ T___ R___

3. Miscellaneous Property in Sec.

S___ T___ R___

S___ T___ R___

LIBER

3 PAGE 310

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, James L. Schwandt, in a field survey on 10-13, 1997 do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L
1												
2		6		5		4		3		2		1
3												
4		7		8		9		10		11		12
5												
6		18		17		16		15		14		13
7												
8		19		20		21		22		23		24
9												
10		30		29		28		27		26		25
11												
12		31		32		33		34		35		36
13												

A. Description of original monument and accessories and/or subsequent restoration:

K-10 T28N-R4W
 G.L.O. W. Warner, 1857
 Mon, Post
 12" Beech N20°W, 12 Links
 14" Beech S25°E, 35 Links

K.J. Ostling #10068, 1972
 4" Concrete Mon
 8" W. Birch N10°W, 14.0'
 7" W. Birch S30°W, 40.2'

N.F. Parker #16939, 1980
 DNR Mon
 Old Fence Cor N81°W, 27.7'

G.D Henning, 1950
 Set Concrete Mon

Dept. Of Natural Resources, 1972
 Found & Used Conc. Mon.

N.F. Parker #16939, 1981
 MDNR Mon

N.F. Parker #16939, 1979
 Concrete Mon w/DNR Post

Frank Arleth, 1990
 Concrete Mon.
 5" Birch S33°W, 40.20'

B. Description of corner evidence found and/or method applied in restoring of established monument:

Fnd. 4" Conc. Mon. w/DNR Post
 Fnd. Blaze Face Stump 12" Birch N10°W, 14.0'
 Fnd. Blaze Face 12" Birch S30°W, 40.2'
 Fnd. Spk. West side 12" Birch N10°W, 14.89'
 Fnd. Spk. West side 12" Birch S30°W, 40.29'
 Fnd. Nail South side 10" Maple S80°W, 55.27'
 Fnd Spk. South side 10" Birch N85°W, 39.10'
 Fnd. Spk. South side 8" Twin Maple N85°E, 44.61'
 Fnd. Nail South side 6" Quad Maple N55°W, 21.32'

CRAWFORD COUNTY
PEER GROUP APPROVAL


DATE OCT 16, 1997

Marvin E. Myers
Marvin E. Myers, P.S.
 County Surveyor

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Replaced 4" Conc. Mon. with C.C.M.
 C.C.M. is accepted as a careful and faithful perpetuation of the position of the original corner.

Fnd. Blaze Face Stump 12" Birch N10°W, 14.0'
 Fnd. Blaze Face 12" Birch S30°W, 40.2'
 Fnd. Spk. West side 12" Birch N10°W, 14.89'
 Fnd. Spk. West side 12" Birch S30°W, 40.29'
 Fnd. Nail South side 10" Maple S80°W, 55.27'
 Fnd Spk. South side 10" Birch N85°W, 39.10'
 Fnd. Spk. South side 8" Twin Maple N85°E, 44.61'
 Fnd. Nail South side 6" Quad Maple N55°W, 21.32'

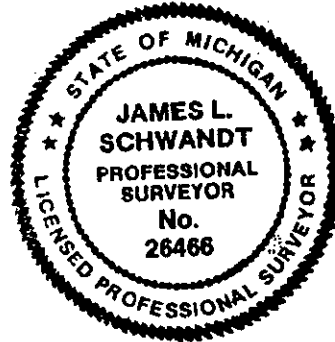

Signed by James L. Schwandt
 Surveyor's Michigan License No. _____

Date 12-15-97