

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY	T. 32 N. R. 5 W.	D-11; D-12
2. PROPERTY CONTROLLING IN SECTION	32, T. 32 N. R. 5 W.	12
3. MISCELLANEOUS PROPERTY IN SECTION	32, T. 32 N. R. 5 W.	ZZ (663.4' S of C-12 & 1,990.1' N of C-13)
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on August 5, 1975, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on August 5, 1975, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

~~A. Description of original monument and accessories and/or subsequent restoration~~
 C. (continued)

ZZ
 Set 1½"x36" pipe & cedar post w/loc. tag
 5" Maple N88°W 23.4
 8" Maple N65°W 41.1
 14" Twin Maple N02°W 13.6
 N-S Random Due W 16.4

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:


- D-11 Reestablished corner per standard B.L.M. instructions.
- D-12 Established center of Section 32 at intersection of one-quarter lines.
- 12 Established one-sixteenth corner equidistant and on line between center of section and south ¼ corner, Section 32.
- ZZ Established SW corner of N½-N½-SW¼ of Section 32 at 663.4' south of W¼ of Section 32 on west line of Section 32. Corner falls in old N-S barbed wire on trees.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

D-11	D-12	12
Set DNR mon. on 6'x1½" pipe & cedar post w/loc. tag	Set 1½"x36" pipe & cedar post w/loc. tag	Set 1½"x36" pipe & cedar post w/loc. tag
9" Cedar S67°W 32.1	9" Y. Birch S12°E 30.2	3" Ironwood N12°W 12.8
10" Cedar N45°W 23.1	9" Cedar N71°W 20.0	8" Maple N69°W 24.0
11" Cedar N70°E 11.3	10" Cedar N33°W 17.4	6" Maple S55°W 17.4
10" Cedar S15°E 35.7	Old RR grade N00°47'E 410'±	12" Maple S41°E 11.1
7" Cedar S18°W 7.5		
E-W Random Due S 4'		

SIGNED BY Carl F. Roser DATE 4-26-76

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

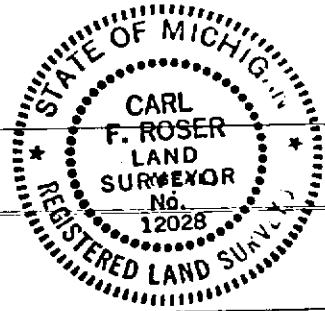

FOR STATE AND UNITED STATES AGENCIES:
 SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR (SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____
 BOYNE VALLEY TOWNSHIP
 CHARLEVOIX COUNTY