

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--:	LOCATED IN--:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>33</u> N. <u>4</u> R. <u>4</u> W.	G-13; H-13
2. PROPERTY CONTROLLING IN SECTION _____	T. _____ N. _____ S. _____ R. _____ E. _____ W. _____	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	T. _____ N. _____ S. _____ R. _____ E. _____ W. _____	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on December 23, 1985, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a

B. Decree of a Court of law:
(Continued):

~~ACCORDING TO DEEDS, RECORDS AND RECORDS AND RECORDS OF RECORDS~~
H-13 - Fits E.A. Robinson's entire Sec. 34 Sur. & Sec. Sub'n.; see Chandler Book, pgs. 24-39; notes in Jury Room in Gov't. Bldg. Fd. Schaaf pipe mon. (set in error - lowered pipe flush w/ground), N70°32'E, 105.4'.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:
G-13 - Recovered definite stake hole shadow with hair roots following stake hole shadow down into ground for Sec. Cor. to Sections 33 & 34 (33-4) & 3 & 4; located from E.A. Robinson N.B.T.s, Hemlock 36" (Hem. stp. remain's on hummock) N14½°W, 40.3' & Sugar 16 (definite soft stp remain's hole), S70°E, 16.3'. Fits E.A. Robinson Sur. of Sec. 34, July 1905. See notes in Jury Room at Gov't. Bldg., Chandler (33-4), pg. 33. Fd. 2" Schaaf pipe mon. (set in error) w/round conc. mon. along side (set by un-known persons), N53°51'E, 82.0'. A foot trail (old logging or wagon rd., NW-SE) is west 88'±.
H-13 - Restored S¼ Cor. Sec. 34 (33-4), N¼ Cor. Sec. 3 (32-4) at double distance & on line across fd. E.A. Robinson's (1905) ctr. post & S 1/8 Cor. on N-S 1/4 line of Sec. 34.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

G-13	H-13	
Set DNR mon. from one E.A.R. wit. remains & cedar post	Set DNR mon. & cedar post	
16" Oak N58°W 8.5'	18" Maple S76°E 46.5'	
15" Oak N56°E 12.5'	13" Maple N82°E 63.0'	
4" Maple S54°E 24.9'	17" Red Pine N56°W 81.2'	
6" Maple S40°W 6.1'	16" Maple S74°W 83.5'	
	E. edge of pipe line clearing (N10°E) East 45'±	
	Ctr. trail in pipeline clearing West 18'±	


SIGNED BY Carl F. Roser 02-07-86 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____
CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____
MICHIGAN REGISTERED LAND SURVEYOR

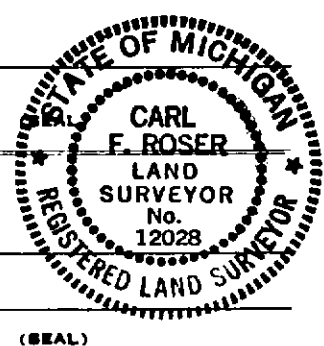

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ CHARLEVOIX COUNTY