

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF--	LOCATED IN--	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____ T. _____	N. S., R. _____ E. W.	_____
2. PROPERTY CONTROL- 34 ING IN SECTION _____, T. 33	N. S., R. 4 _____ E. W.	8; 12
3. MISCELLANEOUS PROPERTY IN SECTION _____, T. _____	N. S., R. _____ E. W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND
FILING NUMBER

I, Carl F. Roser, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on December 23, 1985, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- 8 - Re-established the NE corner of NW $\frac{1}{4}$ of SW $\frac{1}{4}$ of Sec. 34 mid-way & on line between fd. ctr. & W $\frac{1}{2}$ cor. of Sec. 34. Fd. 1" pipe, N26°38'W, 3.52'.
- 12 - Fd. old 1" pipe, surrounded by stones, in line with fence to west. Fits E.A. Robinson (1905) Sur. & Sec. Sub'n. of Sec. 34; see Chandler Bk., pg. 37, notes on file at Jury Rm, in Gov't. Bldg. An old N-S (in curve down hill) wagon road grade in cut-section is 31'± west. An old over-grown N-S grade is 37'± east. A row of large trees (N-S) with some B-W is 20'± east.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

	<u>8</u>		<u>12</u>		
Drove 5/8" x 3/4" rerod w/RLS cap & set cedar post w/loc tag			Fd. old 1" pipe; added RLS cap & set cedar post w/loc tag		
17" Ash N54°W	11.6'		4" Maple N28°E	8.3'	
10" Maple N56°E	15.6'		4" Maple S85°E	3.0'	
6" Maple S24°W	13.3'		8" Ash N30°W	16.5'	

SIGNED BY Carl F. Roser 02-07-86 DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

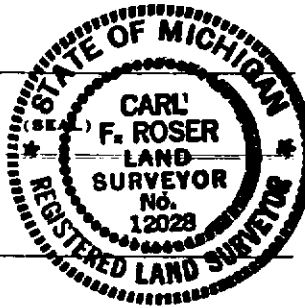

(SEAL)

SURVEYOR'S MICHIGAN REGISTRATION NO. _____ CHARLEVOIX COUNTY

FORM APPROVED BY MICHIGAN STATE BOARD OF REGISTRATION, JAN. 28, 1971
REVISED MAY 14, 1975

MAY PLACE SKETCH ON BACK OR ATTACHED SHEET