

99 NOV 11 PM 2:54

LAND CORNER RECORDATION CERTIFICATE
 Filing Requirement of Act 74, Mich. P.A. 1970

Charlene M. Justice
 REGISTER OF DEEDS

For corners in
 CHANDLER TWP

CHARLEVOIX
 (County)

Located In:

Corner Code #

- | | | |
|------------------------------------|--------------------------|------------|
| 1. Public Land Survey | T <u>33N</u> R <u>4W</u> | <u>B-1</u> |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| | T _____ R _____ | _____ |
| 2. Property Controlling in Section | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |
| 3. Miscellaneous Property in Sec. | S _____ T _____ R _____ | _____ |
| | S _____ T _____ R _____ | _____ |

RECORDED

FEB 03 2000

SECTION

Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____

5. Private Claims _____

I, JAMES E. EVANS, in a field survey on MARCH 15, 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
B-1 NORTH QUARTER CORNER SECTION 6 T33N-R4W

GENERAL LAND OFFICE

THIS CORNER WAS NOT SET BY THE GLO.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
B-1 NORTH QUARTER CORNER SECTION 6 T33N-R4W

Kenneth J. Ostling PS #10068
 Dec. 12, 1961
 Set a 1" pipe
 12" Elm S55°E 27.7' (1)
 12" Elm S74°W 44.2' (2)

John Ferguson PS #24595 LCRC Liber 2 Pg 157
 Found 1" pipe June 17, 1982
 18" Poplar N00°E 56.95' (3)
 8" Maple N17°W 44.18' (4)
 6" Apple S05°W 48.36' (5)
 8" R. Pine S17°W 55.05' (6)


Charlevoix Co. Surveyor
APPROVED
 Signature May C. Ferritt
 Date: Nov. 11, 1999

Distance to corner A-1 Measured 2501.66' (GLO = 2511.3')
 Distance to corner C-1 Measured 2631.34' (GLO = 2640.0')
 Distance to B-13 T34N R4W 11.42' (GLO = 11.55')

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
B-1 NORTH QUARTER CORNER SECTION 6 T33N-R4W

Found 1/2" bar inside 1" pipe. Placed Charlevoix County cast iron monument over 1" pipe. Corner is 4' North of the center line of Bear Creek Road and 50' West of seasonal road to the North.

WITNESSES: 20" Poplar N07°E 57.15' Set pk nail & tag in West side (3)
 15" Tw. Maple N60°W 78.23' Set pk nail & tag in NE side
 10" R. Pine S51°W 62.01' Set pk nail & tag in NW side
 6" Ironwood S30°E 47.55' Set pk nail & tag in NE side
 DNR 1" bar N90°E 11.42' Record = 11.55'

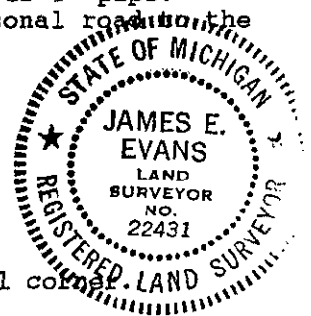

And is accepted as the best available evidence of the position of the original corner.

Signed by *James E. Evans*

Date 11-11-99

Surveyor's Michigan License No. 22431

LIB: P 003 PAGE 270