

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

| FOR CORNERS OF--: | LOCATED IN--: | CORNER CODE NUMBER |
|---|--|--------------------|
| 1. PUBLIC LAND SURVEY _____ | T. 33 N. R. 6 W. ● | L-11; M-11; M-12 |
| 2. PROPERTY CONTROLLING IN SECTION 36 _____ | T. 33 N. R. 6 W. ● | 9; 14 |
| 3. MISCELLANEOUS PROPERTY IN SECTION _____ | T. _____ S. R. _____ E. ● | |
| 4. LOT NO. _____, RECORDED PLAT _____ | | |
| 5. PRIVATE CLAIMS _____ | | |

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Carl F. Roser do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above (identified with circles on index code diagram - over) were, in a field survey on August 30, 1974, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____ 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and of subsequent corners:

C. (continued)

| | 9 | | 14 | | |
|--|------|--|---|------|--|
| Set 1"x6' pipe & cedar post w/loc. tag | | | Set 1 1/4"x60" pipe & cedar post w/loc. tag | | |
| 10" Cedar N10°W | 8.8 | | 9" Cedar S72°W | 13.0 | |
| 12" Y. Birch N55°E | 27.1 | | 9" Cedar N41°E | 13.0 | |
| 12" Cedar S02°W | 28.2 | | 9" Cedar N39°W | 11.2 | |
| in spring flow W & SW 4' wide | | | 1 1/4" pipe S88°W | 14.1 | |

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

- L-11 Found Charlevoix Co. monument in place, by T. Miller, 9/15/63, and by W. R. Downey, October 1963.
- M-11 Found Charlevoix Co. monument in place by T. M. 9/15/63, and W. R. D. 11/5/63.
- M-12 Found plat monument from witnesses by T. M. 9/15/63, and W. R. D.
- 9 Established corner equidistant and on line between 1/4 corner to east and center of Sec. to west. One-inch pipe by others for approx. corner is N33°W, 129.76'.
- 14 Recovered cedar stake from two E. K. Robinson witness (now cedar stumps), from Liber 1, page 293, Corner Survey Record, dated May 18, 1895.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

| | L-11 | | M-11 | | M-12 |
|-------------------------------------|-------|--|--|-------|---|
| Charlevoix Co. mon., set cedar post | | | Fd. Charlevoix Co. mon; set cedar post | | 4" concrete plat monument |
| 12" Ash N75°W | 52.07 | | 16" Maple S42°W | 23.17 | Power pole S85°W 49.75 |
| 20" Maple N38°W | 61.05 | | 12" Maple N35°E | 36.23 | 20" Twn. B. Cherry N54°W 35.75 |
| in fence corner, Fn. E-W-N. | | | 10" Maple S64°E | 19.35 | 32" Maple S87°E 55.43 |
| | | | Power pole S10°W | 3.4 | loc. tag on corner fence post Due W 32.0' |

SIGNED BY Carl F. Roser DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. 12028

FOR STATE AND UNITED STATES AGENCIES:


SIGNED BY _____ DATE _____

CHIEF OF SURVEY PARTY

APPROVED AND SIGNED BY _____ DATE _____

MICHIGAN REGISTERED LAND SURVEYOR

(SEAL)

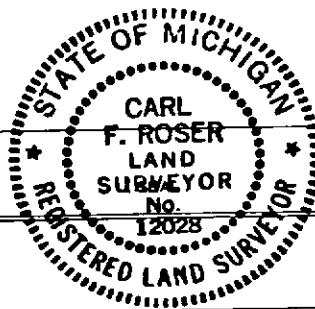

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

EVANGELINE TOWNSHIP
CHARLEVOIX COUNTY

