

99 SEP 16 PH 2:24

LAND CORNER RECORDATION CERTIFICATE  
 Filing Requirement of Act 74, Mich. P.A. 1970

*Carlson B. Jenting*

REGISTER OF DEEDS

For corners in

Charlevoix

(County)

Located In:

Corner Code #

1. Public Land Survey

33N R 8W

F-13

T R

32N R 8W

F-1

T R

2. Property Controlling in Section

S T R

S T R

3. Miscellaneous Property in Sec.

S T R

S T R

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

Wayne E. Boss

MAY 99

I, \_\_\_\_\_, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

F-13 MAY & JUNE 1839 NOVEMBER 3, 1981 NB DEYOUNG, P.S.  
 JOHN HODGSON, DEPUTY SURVEYOR FOUND 1' PIPE AT ROAD BEND  
 SET 1/4 SECTION POST 18" MAPLE S75°E 32.30'  
 BEECH 11 INCH N37°E 19 LINKS 28" MAPLE N40°E 34'  
 BEECH 7 INCH N19°W 20 LINKS 10" MAPLE N35°W 26.2'  
 6" MAPLE WEST 59.80'

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


F-13 MAY 3, 1999  
 FOUND 1 1/4" PIPE AT ROAD BEND WITH FENCE TO NORTH & EAST  
 12" MAPLE N30°W 26.2' FOUND TREE  
 46" MAPLE N45°E 34' FOUND TREE  
 22" MAPLE S54°E 32.30' FOUND TREE  
 10" MAPLE N86° 59.80' FOUND TREE  
 G-13 TO F-13 GLO 40 CHAINS (2640') MEASURES N88°11'56"W 2618.24'  
 F-13 TO E-13 GLO 40 CHAINS (2640') MEASURES N87°47'54"W 2610.11'

Charlevoix Co. Surveyor  
 APPROVED  
 Signature: *Mary C. Ferrall*  
 Date: *Aug 19, 1999*

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

F-13 PLACED CHARLEVOIX COUNTY STEEL MARKER  
 12" MAPLE N30°W 27.52' SET NAIL & TAG  
 46" MAPLE N45(E 35.43' SET NAIL & TAG  
 22" MAPLE S54°E 33.28' SET NAIL & TAG  
 10" MAPLE N86°W 60.09' SET NAIL & TAG

AND IS ACCEPTED AS A CAREFUL & FAITHFUL REESTABLISHMENT OF THE POSITION OF THE ORIGINAL CORNER

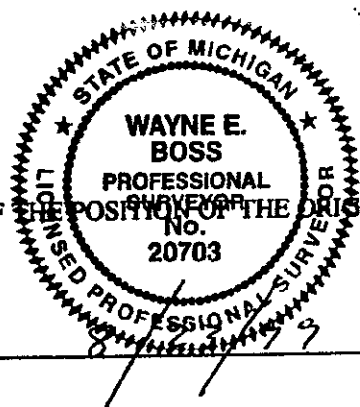

Signed by *Wayne E. Boss*  
 Surveyor's Michigan License No. 20703

Date 8/19/99

LIBR 303 TAG 258