

FEB 04 1999

STATE OF MICHIGAN  
COUNTY OF CHARLEVOIX  
RECEIVED FOR RECORD

98 NOV 13 PM 3:52

SECTION

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in  
Charlevoix twp.  
CHARLEVOIX

(County)

Located In: Corner Code #

1. Public Land Survey	T	<u>34N</u>	R	<u>8W</u>	I-10
	T	_____	R	_____	_____
	T	_____	R	_____	_____
	T	_____	R	_____	_____
2. Property Controlling in Section	S	_____	T	_____	_____
	S	_____	T	_____	_____
3. Miscellaneous Property in Sec.	S	_____	T	_____	_____
	S	_____	T	_____	_____

*Charlene M. Posh...*  
REGISTER OF DEEDS

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

I, James E. Evans, in a field survey on Aug 27, 1998 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

Register of Deeds Stamp & File Number

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

A. Description of original monument and accessories and/or subsequent restoration:

I-10 Quarter Corner common to sections 26 & 27 T34N - R8W

GLO Set Quarter Section post	E.K. Robinson 1892 Found stone	D.C. Nettleton 1896 Found stone
8" Hemlock N25°W 18 lks (11.88')	Placed glass around stone	Set 1" x 1" iron pin
20" Hemlock S65°E 22 lks (14.52')	1 foot deep	
Ch W Cathcart DS 10-22-1841		

Lawrence R. Feindt PS #215667-20-76 Shows corner falls on manhole cover No witnesses  
George Avendt PS #160347-13-87 Shows corner on manhole Witness PK nail N13°57'40"E 1.62' PK nail S13°57'40"E 0.76'  
Mary C Feindt PS #392012-19-90 Shows corner on manhole Same witnesses as above

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

I-10 Quarter Corner common to sections 26 & 27 T34N - R8W

Found manhole at recorded location at intersection of Antrim St. and State St. Both Pk nails are gone

Distance to H-10: Meas = 2637.28 ft  
Distance to I-11: Record = 2649.47 ft Meas = 2649.38 ft

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I-10 Quarter Corner common to sections 26 & 27 T34N - R8W

Computed corner location from various surveys adjacent to the corner  
Set chisel marks on 4 sides of manhole rim to intersect at computed location


WITNESSES: Guy pole N68°W 73.85' Set nail and tag in South side  
Utility pole N54°E 37.42' Set nail and tag in SE side  
NW corner block bldg, S63°E 85.32'  
Center top of fire hydrant S84°W 125.56'

Charlevoix Co. Surveyor  
APPROVED  
Signature Mary C. Feindt  
Date: Oct. 8, 1998

AND IS ACCEPTED AS A CAREFUL AND FAITHFUL PERPETUATION OF THE POSITION OF THE ORIGINAL CORNER.

Signed by \_\_\_\_\_ Date 10-8-98

Surveyor's Michigan License No. 22431

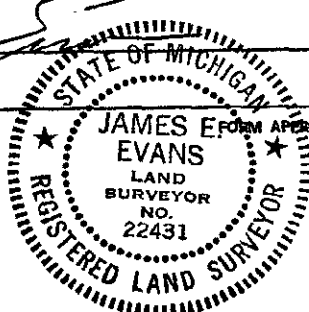

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 26, 1971  
REVISED MAY 14, 1975  
REVISED JAN., 1983  
REVISED OCT., 1996