

1999 CHEBOYGAN COUNTY REMONUMENTATION

RECEIVED FOR RECORD

99 DEC 27 PM 4: 21

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

Cheryl Pappas
CLERK/REGISTER
CHEBOYGAN COUNTY MICHIGAN

For corners in

| | | |
|------------------------------------|--------------|---------------|
| <u>CHEBOYGAN</u> (County) | Located In: | Corner Code # |
| 1. Public Land Survey | T34NR1E | F-5 |
| | T___R___ | _____ |
| | T___R___ | _____ |
| | T___R___ | _____ |
| 2. Property Controlling in Section | S___T___R___ | _____ |
| | S___T___R___ | _____ |
| 3. Miscellaneous Property in Sec. | S___T___R___ | _____ |
| | S___T___R___ | _____ |

RECORDED

MAR 03 2000

SECTION
Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____

I, Ronald Bischer, in a field survey on Aug 11 1999 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and /or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

| | | | | | | | | | | | | |
|----|----|---|----|---|----|---|----|---|----|---|----|---|
| A | B | C | D | E | F | G | H | I | J | K | L | M |
| 1 | | | | | | | | | | | | |
| 2 | 6 | | 5 | | 4 | | 3 | | 2 | | 1 | |
| 3 | | | | | | | | | | | | |
| 4 | 7 | | 8 | | 9 | | 10 | | 11 | | 12 | |
| 5 | | | | | | | | | | | | |
| 6 | 18 | | 17 | | 16 | | 15 | | 14 | | 13 | |
| 7 | | | | | | | | | | | | |
| 8 | 19 | | 20 | | 21 | | 22 | | 23 | | 24 | |
| 9 | | | | | | | | | | | | |
| 10 | 30 | | 29 | | 28 | | 27 | | 26 | | 25 | |
| 11 | | | | | | | | | | | | |
| 12 | 31 | | 32 | | 33 | | 34 | | 35 | | 36 | |
| 13 | | | | | | | | | | | | |

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
F-5

1855 GLO Notes Resurvey:
N10°E 31 lks 16" Beech
S02°W 9 lks 6" Hemlock

Nov. 9, 1973 Delmer Porter #15410
Cons, Marker
S21°E 16.24' 12" Beech
N08°W 18.62' 7" Maple
N86°W 40.19' 8" Maple in clump

April 2, 1960 Dean Delamater
1" pipe with brass cap
N60°E 17.5' 9" Beech
S36°E 16.0' 10" Beech

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:


F-5
Aug. 11, 1999 Cheboygan County Remonumentation
Ronald Bischer #22428
found all old witnesses and left 2 new ones



C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

F-5
Conservation Marker
N08°W 18.62' 9" Maple
N89°W 40.19' 12" Maple in clump
S31°E 16.24' 15" Beech
S58°E 20.06' 12" Beech
North 110' centerline of 2-track

LIBER 011 PAGE 176

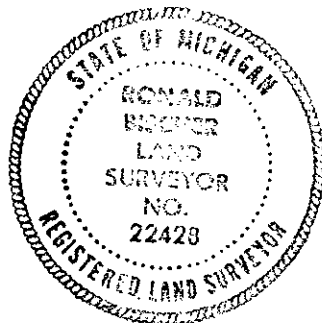

Signed by Ronald R. Bischer
Surveyor's Michigan License No. 22428

Date 12-18-99