

SURVEY &  
REMONUMENTATION

MAR 8 1999

1998  
CHEBOYGAN COUNTY REMONUMENTATION  
LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

SECTION

For corners in  
Cheboygan

(County)	Located In:	Corner Code #
1. Public Land Survey	T36N R 3W	J-1 ✓
	T37N R 3W	J-13
	T___ R___	_____
	T___ R___	_____
2. Property Controlling in Section	S___ T___ R___	_____
	S___ T___ R___	_____
3. Miscellaneous Property in Sec.	S___ T___ R___	_____
	S___ T___ R___	_____

RECEIVED FOR RECORD 1-8-99  
at 9:13 O'Clock A M  
*Joanne Spray*  
CLERK/REGISTER  
CHEBOYGAN COUNTY, MICHIGAN  
Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

I, Brian K. Fullford, in a field survey on June, 1998 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and for that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													


NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

1840 John Mullett Original Survey Set 1/4 post 6" Hemlock N 45° W 16 lks 10" Beech N 45° E 20 lks	1905 David Bowen County Surveyor Fnd Cedar post 2 1/2" Sq. w/gun barrel driven along side No wits given
---	---

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

Fnd 3/4" pipe in center of small stone pile  
10" Maple S 15° E 21.65' w/ old blaze  
12" Maple S 38° W 27.69' w/ old blaze  
12" Poplar S 81° W 34.22' w/ old blaze  
18" Poplar S 79° E 5.60' w/old blaze located in wooded area at SW corner of farm field 100' +/- into woods

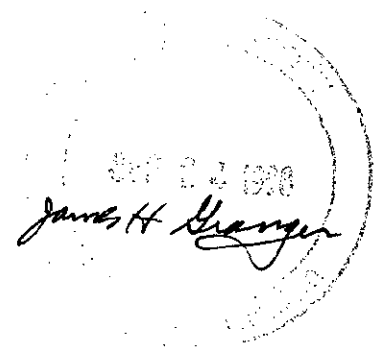

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

**J-1** Placed 5/8" rebar with remonumentation cap inside pipe, and position is accepted as a careful and faithful perpetuation of the original corner.

12" Maple N 18° E 48.65'	Set tag 41099
10" Maple S 15° E 21.65'	Set tag 41099
12" Maple S 38° W 27.69'	Set tag 41099
12" Poplar S 81° W 34.22'	Set tag 41099

NOTE: THIS CORNER IS ALSO DESIGNATED AS CODE J-13 IN T37N-R3W.

Signed by *B. K. Fullford*  
Surveyor's Michigan License No. 41099

Date 11/23/98

