

**CHEBOYGAN COUNTY REMONUMENTATION CORNER
JAN 23 1996 LAND CORNER RECORDATION CERTIFICATE
COMMISSION Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

<u>CHEBOYGAN</u> (County)	Located In:	Corner Code \neq
<u>Burt Township</u>		
1. Public Land Survey	T <u>36N</u> R <u>3W</u>	<u>M-6</u>
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

RECEIVED
FOR RECORD
95 SEP 18 AM 10:17
Joanna Spray
CLERK/REGISTER
CHEBOYGAN COUNTY, MICHIGAN
Register of Deeds Stamp & File Number

4. Lot No. _____, Recorded Plat _____
5. Private Claims _____


I, Ronald Bischer, in a field survey on July 6, 19 95, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	13		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:
 1840 Original Survey N20°30'W 72.20' 10" Oak
 John Mullett 1972 Survey
 Set wood post Orlando Doyle #7319
 20" Hemlock N65°W 47 lks same as in 1969
 12" Beech S11°W 20 lks 1972 Survey
 1969 Survey Orlando Doyle #7319
 Orlando Doyle #7319 same as in 1969
 Set 1" Pipe 1979 Survey Found 1" Pipe
 S87°30'E 40.85' Power pole Ronald R. Bischer #22428 N87°E 40.81' P. pole
 S52°30'W 37.58' 5" Oak (1 of 3) N20°W 72.16' 12" Oak S52°W 37.45' 6" Oak


B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
 Found 1" Pipe, replace pipe with 5/8" Rod and Cheboygan County Remonumentation cap.
 Due East 40.95' Power pole
 N23°W 72.16' 16" Red Oak
 S49°W 37.95' 9" Red Oak
 S20°W 27.75' 1 1/2" Leaf spring - witnessed with spikes

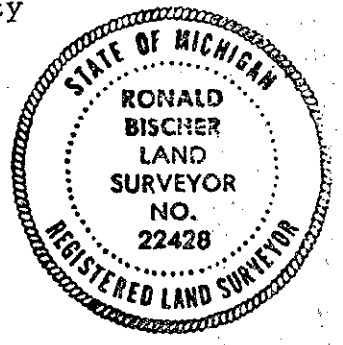

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
 5/8" Rod with Cheboygan County Remonumentation cap
 Due East 40.95' Power pole
 S49°W 37.95' 9" Red Oak
 N23°W 72.16' 16" Red Oak
 N58°E 15.40' 4" Maple

Nails with witness tag #22428 used.

Morris A. [Signature]

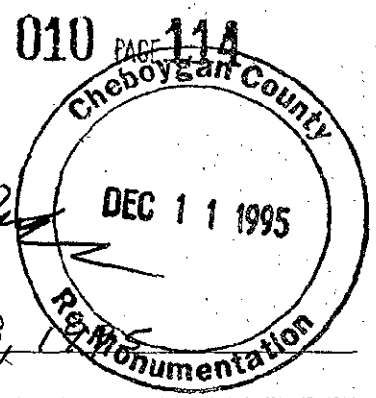

Recorded by Ronald R. Bischer Date July 28, 1995
 Surveyor's Michigan License No. 22428