

Benton 1993  
105 COMMISSION

CHEBOYGAN COUNTY REMONUMENTATION CORNER  
LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

For corners in

CHEBOYGAN (County)	Located In:	Corner Code #
1. Public Land Survey	T 37N R 1E	A-6
	T _____ R _____	_____
	T _____ R _____	_____
	T _____ R _____	_____
2. Property Controlling in Section	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____
3. Miscellaneous Property in Sec.	S _____ T _____ R _____	_____
	S _____ T _____ R _____	_____

RECEIVED  
FOR RECORD  
93 DEC 22 AM 10:23  
*James Spray*  
CLERK/REGISTER  
CHEBOYGAN COUNTY, MICHIGAN  
Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6		5		4		3		2		1		
3													
4	7		8		9		10		11		12		
5													
6	18		17		16		15		14		13		
7													
8	19		20		21		22		23		24		
9													
10	30		29		28		27		26		25		
11													
12	31		32		33		34		35		36		
13													

I, Ronald R. Bischer, in a field survey on September 22, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

A-6  
Original Survey (June 1840)  
John Hodgson set Wood Post  
7" Beech N10 E 13 links  
7" Maple S44 E 12 links  
1963 - Kenneth Ostling  
Found 1-1/2" Pipe - did not witness  
1965 - Kenneth Ostling  
Found 1-1/2" Pipe  
Replaced Pipe with Conservation Monument  
24" Red Pine N61 E 48.2'  
22" Red Pine S43 E 47.7'  
1966 - Kenneth Larsen  
Conservation Monument  
same witnesses as above

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

A-6  
Found Conservation Department Monument  
24" Red Pine N61 E 48.2'  
22" Red Pine S43 E 47.7'  
set nail with tag #22428 at recorded distance on these witnesses.




LIBER 010 PAGE 19

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

A-6  
Conservation Department Monument  
N61 E 48.20' 24" Red Pine  
S43 E 47.70' 22" Red Pine  
S36 E 15.70' 5" White Pine  
N78 W 11.36' 8" Maple  
Set nail with witness tag #22428 in witnesses.

*Maurice A. Rose*

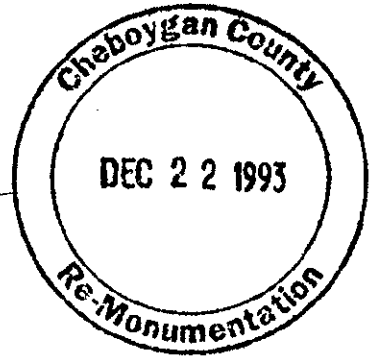

Signed by Ronald R. Bischer Date 12-03-93  
Surveyor's Michigan License No. 22428