

# SURVEY & REMONUMENTATION

MAR 21 1997

**COMMISSION**

Approved By Delta County  
Land Survey Remonumentation  
Peer Group Under Act 345 Of  
P.A. Of 1990 On 12/12, 1996

## LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

*Shirley Belmelwig*  
Chairman

For corners in  
DELTA  
(County)

Located In: Corner Code #

- |                                    |                         |            |
|------------------------------------|-------------------------|------------|
| 1. Public Land Survey              | T 38 N R 19 W           | C-9 & C-10 |
|                                    | T _____ R _____         |            |
|                                    | T _____ R _____         |            |
|                                    | T _____ R _____         |            |
| 2. Property Controlling in Section | S _____ T _____ R _____ |            |
|                                    | S _____ T _____ R _____ |            |
| 3. Miscellaneous Property in Sec.  | S _____ T _____ R _____ |            |
|                                    | S _____ T _____ R _____ |            |

Recorded DEC 20 1996  
at 2:00 o'clock PM  
Liber 8 Page 155  
*William C. Thomas*  
Delta County, MI Reg. of Deeds

**Register of Deeds Stamp & File Number**

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_
5. Private Claims C-9 [NW COR S29] C-10 [W1/4 COR S29]

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	18	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

I, M.P. DAVIS, in a field survey on NOVEMBER, 1996, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

**NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.**

**A. Description of original monument and accessories and/or subsequent restoration:**


C-9 [NW COR S29] WOOD POST - A.MERRYWEATHER, D.S. - 1848 (BASSWOOD 12"-N52°W-12 LINKS) (BIRCH 10"-S45°E-19 LINKS) M.S.McNABB-1925-FOUND IRON BOLT IN ROAD "FROM PREVIOUS SURVEYS" (MAPLE 9"-S28°E-39.4')(MAPLE 3'-N66°W-57.0')

C-10 [W1/4 COR S29] WOOD POST - A.MERRYWEATHER, D.S. - 1848 (SUGAR 07"-N75°W-26 LINKS) (SUGAR 13"-S64°E-07 LINKS) M.S.McNABB-1925-ORIGINALS DESTROYED ESTABLISHED 1/2 DISTANCE BETWEEN COR'S (BEECH 12"-N80°E-38.6')(BEECH 6"-S45°E-29.80')

**B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:**

C-9 [NW COR S.29] FOUND IN PLACE & 24" BELOW ROAD SURFACE AN IRON BOLT, NO EVIDENCE OF McNABB'S 1925 BT'S FOUND. DISTANCES SOUTH TO 1/4 COR CHECKS WELL WITH THE RECORDS OF McNABB. ACCEPTED EXISTING MONUMENT AS BEING THE BEST AVAILABLE EVIDENCE AS TO THE POSITION OF THE ORIGINAL CORNER.

C-10 [W1/4 COR S.29] FOUND IN PLACE AND 15" BELOW ROAD SURFACE AND IRON BOLT. 1D CORNER MONUMENT AS THAT BEING SET BY McNABB FROM THE STUMP OF HIS BEECH BT TO THE NE AND IS 0.8' EAST & 1.54 SOUTH OF THE MIDPOINT BETWEEN SECTION CORNERS. ACCEPTED EXISTING MONUMENT AS BEING A CAREFUL AND FAITHFUL REESTABLISHMENT OF THE POSITION OF THE ORIGINAL CORNER.

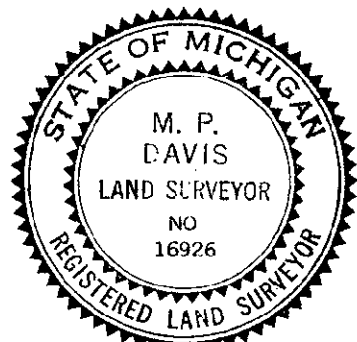

**C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:**

C-9 SET OVER EXISTING IRON BOLT A 5/8" X 18" REBAR W/A 3 1/4" ALUMN CAP STAMPED TO ID THE CORNER POSITION & SET 6" BELOW RD GRADE.

MAPLE 10"	MAPLE 14"	IRONWOOD 11"	MAPLE 08"
N46°E	S.60°E	N63°W	S61°W
65.28'	65.98'	56.75	43.40'

C-10 SET OVER EXISTING MON & 6' BELOW GRADE A 5/8" X 10" REBAR W/A 3 1/4" ALUM CAP STAMPED TO ID THE CORNER POSITION.

MAPLE 8"	MAPLE 7"	MAPLE 10"	BEECH 17"
N42°W	S45°W	S52°E	S65°W
45.75'	51.68'	38.80'	51.72'

NOTE: BEARINGS TO REFERENCE OBJECTS ARE MAGNETIC - DISTANCES ARE TO A NAIL IN THE CENTER OF THE OBJECT UNLESS NOTED OTHERWISE

Signed by M.P. Davis Date 12/10/96  
Surveyor's Michigan License No. 16926