## SURVEY & REMONUMENTATION

DEC 07 1993

COMMISSION

Lot No.

Approved By Delta County

Land Survey	Remonumentation
Peer Group	Under Act 345 Of
A_Of.1990 Op	Devember 3 0 199

P.AQf,1990 Op/	<u>د 199 ک د میسوسیم</u>
	limeling
Mun deta	timeling

## LAND CORNER RECORDATION CERTIFICATE Culture chairman Filing Requirement of Act 74, Mich. P.A. 1970

DELTA	Located In:	Corner Code ##	
(County)			
Public Land Survey	T 39 N R 23 W T R T R T R	(1-7) H-7	

DELTA COUNTY

LIBER 7 PAGE 330

93 DFC -2 AM 9:00

Vatlag C. Zlogg. REGISTER OF DEEDS

Register of Deeds Stamp & File Number


2. Property Controlling S Т in Section Miscellaneous Property in Sec.

\_ , Recorded Plat \_

Private Claims
I-7 [NW COR SEC 23] H-7 [1/4 COR COMMON TO SEC'S 15/22]

M.P. DAVIS in a field survey on . AUGUST do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

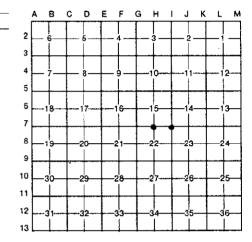

- Description of original monument and accessories and/or subsequent restoration:
  - I-7 [NW COR SEC 23] WOOD POST-A.MERRYWEATHER-1846 (HEMLOCK 10\*-N3°W-5 LINKS) (BIRCH 14\*-S50°E-8 LINKS)
    - H.S. McNABB-1938-CEDAR STAKE IN PLACE (W.PINE 9"-S10"E-55.5") (W.PINE 9"-N45"W-45")
    - M. DAVIS-1970-SET 1-1/4" I.P. PER L.C.R'S. IN LIBER 4 PAGE 186
  - H-7 [1/4 COR COMMON TO SEC'S 15/22] WOOD POST-A.MERRYWEATHER-1846 (CEDAR 12"-N23°E-8 LINKS) (BIRCH 15"-S30°W-8 LINKS)
    - M. DAVIS-1975-SET 3/4" X 18" I.P. W/A SURVEY CAP PER L.C.R'S IN LIBER 2 PAGE 132
- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
  - I-7 [NW COR SEC 23] FOUND MONUMENT AS DESCRIBED IN L.C.R'S. IN LIBER 4 PAGE 186
  - H-7 [1/4 COR COMMON TO SEC'S 15/22] FOUND MONUMENT AS DESCRIBED IN L.C.R'S. IN LIBER 2 PAGE 132



- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
  - 1-7 SET, OVER EXISTING MONUMENT, A BERNTSEN ALNB30 ALUMINUM MONUMENT W/A 3-1/4" CAP STAMPED TO ID THE COR POSITION

SURVEY MON SIGN POST

NW COR CONC TRAP HOUSE

NORTH 2.75' TO FACE

S4°E - 207.70'

COR POSITION IS IN MIDDLE OF GREAT LAKES SPORTS CLUB TRAP RANGE NO OTHER WIT'S NEAR

H-7 SET, OVER EXISTING MONUMENT, A BERNISEN AINB30 ALUMINUM MONUMENT W/A 3-1/4" CAP STAMPED TO ID THE CORN POSITION

TWIN MAPLES 5" MAPLE 68 MAPLE 7" MAPLE 8\* SURVEY MON SIGN POST S54°W N26°W N65°E \$28°E NORTH 2.82' (TO FACE) 26.66 29.701 26.12 26.62

NOTE: BEARINGS TO REFERENCE, OBJECTS ARE MAGNETIC & DISTANCE ARE TO A NAIL IN THE CENTER OF THE OBJECT UNLESS NOTED OTHERWISE

Surveyor's Michigan License No.

16926