

MONUMENTATION

FEB 22 1996

COMMISSION

LAND CORNER RECORDATION CERTIFICATE

Filing Requirement of Act 74, Mich. P.A. 1970

Approved By Delta County Land Survey Remonumentation Peer Group Under Act 345 Of P.A. Of 1990 On Jan. 60, 1994

*Robert B. Shumling*  
Acting Chairman

For corners in

DELTA

(County)

Located In:

Corner Code #

1. Public Land Survey	T	40 N	R	23 W	A-2 & A-10
	T		R		
	T	40 N	R	24 W	M-10
	T		R		
2. Property Controlling in Section	S		T		
	S		T		
3. Miscellaneous Property in Sec.	S		T		
	S		T		

Recorded January 21, 1994

at 00 o'clock p.m. in Lib. 7 Page 368

*Robert C. Thomas*  
Reg. of Deeds  
Delta County, Michigan

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
 5. Private Claims  
 A-2 [W1/4 COR SEC 6] A-10 [W1/4 COR SEC 30]  
 SAME AS M-2 T40N R24W & M-10 T40N R24W


A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1						
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

I, M. P. DAVIS, in a field survey on JULY, 19 93, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

- A. Description of original monument and accessories and/or subsequent restoration:
- A-2 [W1/4 COR SEC 6] WOOD POST - JOHN BURT, D.S. - 1844 (Y. BIRCH 16"-SW-44 LINKS) (CEDAR 20"-NE-21 LINKS)  
M.S. McNABB - 1919 - FOUND LARGE SCRIBED WOOD POST IN PLACE, VERIFIED POSITION FROM GLO STREAM X-ING CALLS NORTH TO HARMON CREEK & THE ESCANABA RIVER. WITNESSED TO POPPLE 6"-S55°E-24'.
  - A-10 [W1/4 COR SEC 30] WOOD POST - JOHN BURT, D.S. - 1845 (HEMLOCK 7"-N30°W-14 LINKS) (HEMLOCK 18"-N25°E-55 LINKS)  
M.S. McNABB - 1916 - IDENTIFIED BY STAKE IN ROAD SHOWN TO HIM BY SETTLERS (BT POST NE & SW 33') DROVE IRON BOLT  
M.S. McNABB - 1924 - IRON STAKE & BT POST FROM ABOVE STILL IN PLACE

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:
- A-2 [W1/4 COR SEC 2] FOUND LARGE SCRIBED POST IN PLACE - ID SAME FROM McNABB'S DISTANCES NORTH TO HARMON CREEK & ESCANABA RIVER, ACCEPTED EXISTING MONUMENT AS A CAREFUL & FAITHFUL REESTABLISHMENT OF THE POSITION OF THE ORIGINAL CORNER.
  - A-10 [W1/4 COR SEC 30] FOUND McNABB'S IRON BOLT 36" BELOW EXISTING ROAD SURFACE IDENTIFIED CORNER POSITION FROM ANCIENT N-S OCCUPATION LINE & E-W COUNTY ROAD CONSTRUCTION, ACCEPTED EXISTING MONUMENT AS A CAREFUL & FAITHFUL REESTABLISHMENT OF THE POSITION OF THE ORIGINAL CORNER.

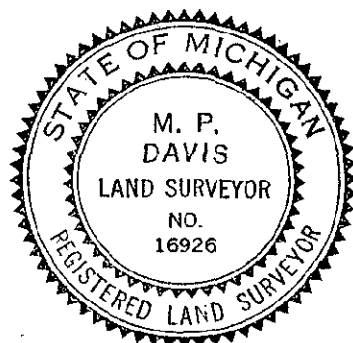

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
- A-2 REPLACED WOOD POST W/A 4" X 4" X 36" CONCRETE MONUMENT W/A BRASS CAP STAMPED TO ID THE CORNER POSITION  
 MAPLE 5" CEDAR 10" CEDAR 10" ASH 5" SURVEY MONUMENT SIGN POST  
 N80°W N72°E S32°E S37°W SOUTH  
 47.68' 41.47' 34.88' 58.42' 2.72' (TO FACE)
  - A-10 SET 5/8" X 18" REBAR W/A 3-1/4" ALUMN CAP STAMPED TO ID THE COR POSITION & RAISED TO ROAD SURFACE W/A MONUMENT BOX  
 SE COR GARAGE CEDAR 5" SURVEY MONUMENT SIGN POST MAPLE 9"  
 N46°W N46°E SOUTH S37°W  
 38.65' 65.87' 20.55' (TO FACE) 42.15'

NOTE: BEARINGS TO REFERENCE OBJECTS ARE MAGNETIC & DISTANCES ARE TO A NAIL IN THE CENTER OF THE OBJECT UNLESS OTHERWISE NOTED

Signed by M.P. Davis Date 12/29/93  
 Surveyor's Michigan License No. 16926