

JAN 25 2000

SECTION

LAND CORNER RECORDATION CERTIFICATE  
Filing Requirement of Act 74, Mich. P.A. 1970

Approved By Delta County  
Land Survey Remonumentation  
Peer Group Under Act 345 Of  
P.A. Of 1990 On Dec 28, 1999

*Robert E. Schmeling*  
Chairman

For corners in

DELTA (County)	Located In:	Corner Code #
1. Public Land Survey	T 43 N R 20 W	K-03
	T 43 N R 20 W	K-04 <input checked="" type="checkbox"/>
	T R	
	T R	
2. Property Controlling in Section	S T R	
	S T R	
3. Miscellaneous Property in Sec.	S T R	
	S T R	

01-04-00  
2:00 PM  
9 PAGE 179  
Register of Deeds Stamp & File Number

K-03 [NW COR SEC 12] K-04 [W1/4 COR SEC 12]

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_  
5. Private Claims \_\_\_\_\_

I, M.P. DAVIS, in a field survey on DECEMBER, 19 99 do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, recovered, found as expressed below:

NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.


A	B	C	D	E	F	G	H	I	J	K	L	M
1												
2	6	5	4	3	2							
3												
4	7	8	9	10	11	12						
5												
6	18	17	16	15	14	13						
7												
8	19	20	21	22	23	24						
9												
10	30	29	28	27	26	25						
11												
12	31	32	33	34	35	36						
13												

A. Description of original monument and accessories and/or subsequent restoration:

- K-03 [NW COR SEC 12] A.MERRYWEATHER,D.S.-1848-WOOD POST (BIRCH 12" S46°E 27 LINKS)(SUGAR 12" N35°W 51 LINKS) ROBERT E. SCHMELING-ESCANABA PAPER CO.-1953-L.3 PG.3 OF LCR'S-SET, FROM "GLO" BT SW, AN I.P. W/A 3" BRASS CAP STAMPED TO ID THE CORNER POSITION.(H.MAPLE 12" N40°E 225 LINKS)(H.MAPLE S62°E 279 LINKS)
- K-04 [W1/4 COR SEC 12] A.MERRYWEATHER,D.S.-1848-WOOD POST (HEMLOCK 18" S10°E 16 LINKS)(POPLAR 12" NORTH 06 LINKS) NO RECORD EVIDENCE OF CORNER RECOVERY AND/OR SUBSEQUENT MONUMENTATION.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

- K-03 [NW COR SEC 12] FOUND IN PLACE A 1-1/4" IRON PIPE W/A 3" BRASS CAP ATTACHED AND STAMPED TO ID THE CORNER POSITION. NO EVIDENCE OF THE SCHMELING BT'S AS LISTED ABOVE. AS EXISTING MONUMENT APPEARS TO BE UNDISTURBED ACCEPTED SAME AS BEING A CAREFUL AND FAITHFUL PERPETUATION OF THE POSITION THE ORIGINAL CORNER.
- K-04 [W1/4 COR SEC 12] NO CORNER EVIDENCE FOUND. REESTABLISHED CORNER POSITION ON LINE WITH AND AT THE MIDPOINT BETWEEN THE SEC CORNERS 1/2 MILE TO THE NORTH AND SOUTH.

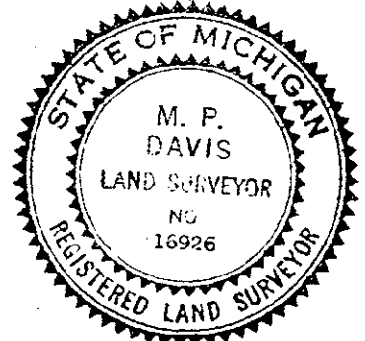

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

- K-03 DID NOT DISTURB EXISTING MONUMENT.
 

W. CHERRY 10"	W. CHERRY 06"	W. PINE 07"	SURVEY MONUMENT SIGN POST
N42°W	N77°E	S11°W	NORTH
24.34'	9.47'	34.40'	2.79' (TO FACE)
- K-04 SET A BERNTSEN A1NB30 ALUM MONUMENT WITH THE CAP STAMPED TO ID THE CORNER POSITION.
 

SPRUCE 04"	HEMLOCK 22"	SPRUCE 10"	W. PINE 12"	SURVEY MONUMENT SIGN POST
N40°W	N54°E	S85°E	S14°W	NORTH
69.40'	53.93'	65.63'	56.43'	1.15' (TO FACE)

NOTE: BEARINGS TO REFERENCE OBJECTS ARE MAGNETIC-DISTANCES ARE TO A NAIL W/A DELTA COUNTY REFERENCE TAG, UNLESS OTHERWISE NOTED.

Signed by M.P. Davis  
Surveyor's Michigan License No. 16926

Date 12/20/99