

MAY 07 1997

COMMISSION

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED

1996 DEC 18 AM 11:17

For corners in

DICKINSON


(County)

Located in:

Corner Code #

WAUCEDAH TWP.

- 1. Public Land Survey T 40N R 28W
2. Property Controlling in Section S T R
3. Miscellaneous Property in Section S T R

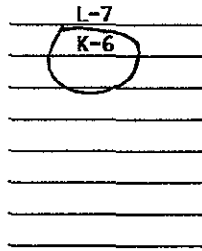

REGISTER OF DEEDS
DICKINSON COUNTY
IRON MOUNTAIN, MI. 49801

19

Register of Deeds Stamp & File Number

- 4. Lot No.
5. Private Claims

I, ROBERT F. PERKINS, in a field survey on 10-24, 19 96, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Professional Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

Grid table with columns A-L and rows 1-13. Markers are shown at grid intersections 13-13 and 13-14.

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

A. Description of original monument and accessories and/or subsequent restoration:

L-7 1/4 CORNER COMMON TO SECTIONS 13 & 24
POST BY J. MULLETT, D.S. 1849
ORIGINAL BEARING TREES
BIRCH 3" S88°E 07 L.
LYNN 14" N22°E 13 L.

K-6 1/4 CORNER COMMON TO SECTION 14/13
POST BY J. H. MULLETT, D.S. 1849
ORIGINAL BEARING TREES
TAMARACK 8" S18°E 11 L.
TAMARACK 8" S88°W 06 L.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

L-7 NO EVIDENCE OF ORIGINAL CORNER OR ACCESSORIES FOUND.
FOUND 1" IRON PIPE WITH 4" D.N.R. BRASS CAP SET BY B. BUCKLER 2-23-1960
BT PROPORTIONATE MEASURE.
1960 BEARING TREES
HARD MAPLE 9" S13°E 65 1/2 L.
HARD MAPLE 8" S88°E 64 1/2 L.

K-6 FOUND OLD SQUARE CEDAR POST WITH REMAINS OF MUCH OLDER POST DOWN.
FOUND CEDAR 18" WITH VISIBLE SCRIBING N31°W (M.B.) 20.62'
BRUSHED LINE RUNS EAST AND WEST AND PAINT LINE RUNS SOUTH FROM POST.
GLO CALL LEAVE SWP. 42.00' CHECKS WELL.

ACCEPTED BY THE DICKINSON COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD ON

12-17-96

Signature

COUNTY REPRESENTATIVE

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

L-7 FOUND ABOVE DESCRIBED MONUMENT AND BEARING TREES IN PLACE.
NEW BEARING TREES:
HEMLOCK 16" S69°W (M.B.) 20.80' NAIL/TAG
DBL. BEECH 6" N10°E (APPROX.) 26.92' NAIL/TAG
S. MAPLE 12" S88°E (M.B.) 42.50' OLD B.T.
S. MAPLE 12" S10°E (M.B.) 43.05' OLD B.T.
PLACED CARSONITE WITNESS STAKE ± 1.0' SOUTH.

K-6 ACCEPTED ABOVE POST AS BEST AVAILABLE EVIDENCE OF CORNER LOCATION.
SET 3 1/2" STAMPED D.C. REMON. CORNER AT POST.
NEW BEARING TREES:
CEDAR 18" N31°W (M.B.) 20.62' OLD B.T.
CEDAR 20" N12°E (M.B.) 11.80' OLD B.T.
CEDAR 12" S60°W (M.B.) 31.30' NAIL/TAG
B. SPRUCE 6" S26°E (M.B.) 25.62' NAIL/TAG
PLACED CARSONITE MARKER 1.0' NORTH OF OLD CORNER.

Signed by [Signature]

Date NOVEMBER 6, 1996

Surveyor's Michigan License No. 12027

FORM APPROVED BY MICHIGAN STATE BOARD OF PROFESSIONAL SURVEYORS, JAN. 28, 1977, REVISED MAY 14, 1988

