

**LAND CORNER RECORDATION CERTIFICATE**  
**Filing Requirement of Act 74, Mich. P.A. 1970**

For corners in

Dickinson

(County)

Located in:

Corner Code #

1. Public Land Survey

T \_\_\_ R \_\_\_  
 T \_\_\_ R \_\_\_  
 T \_\_\_ R \_\_\_  
 T \_\_\_ R \_\_\_

2. Property Controlling in Section

S 6 T 40N R 29W 9  
 S 6 T 40N R 29W 13

3. Miscellaneous Property in Sec.

S \_\_\_ T \_\_\_ R \_\_\_  
 S \_\_\_ T \_\_\_ R \_\_\_

Register of Deeds Stamp & File Number

4. Lot No. \_\_\_\_\_, Recorded Plat \_\_\_\_\_

5. Private Claims \_\_\_\_\_

13 Mar 01 2001  
 9 Mar 05 2001

I, Stephan J. Szyszkoski, in a field survey on \_\_\_\_\_, 19\_\_\_\_ do hereby state that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law, established, re-established, monumented, recovered, found as expressed below.


NOTE: Not more than 2 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
1													
2	6			5		4		3		2		1	
3													
4	7			8		9		10		11		12	
5													
6	10			17		16		15		14		13	
7													
8	19			20		21		22		23		24	
9													
10	30			29		28		27		26		25	
11													
12	31			32		33		34		35		36	
13													

- A. Description of original monument and accessories and/or subsequent restoration:  
 (9-Sec. 6) East 1/16 corner, Section 6. Corner not established in the original survey.  
 (13-Sec. 6) Southeast 1/16 corner, Section 6. Corner not established in the original survey.

- B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:  
 (9-Sec. 6) Established the corner midway and on a straight line between Center of Section 1321.01' West and Quarter corner 1321.01' East.  
 (13-Sec. 6) Established the corner at the intersection of straight lines connecting opposite 1/16 corners.

- C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:  
 (9) Set 1" ID iron pipe capped with a 4" dia. aluminum MDNR tablet. Blazed and scribed the following:  
 11" W. Birch N19E 4.3'      "1/16S BT"  
 5" Sugar S78E 10.8'      do  
 4" Sugar S31E 16.7'      do  
 4" Sugar S79W 30.0'      do  
 Placed squared cedar post adjacent.  
 Bearings are magnetic. Distances are to notch in lower blaze.  
 (13) Set 1" ID iron pipe capped with a 4" dia. aluminum MDNR tablet. Blazed and scribed the following:  
 4" Cedar N7E 8.8'      "1/16S BT"  
 6" Cedar N67E 29.1'      do  
 6" dbl Sugar S10E 11.2'      do  
 6" Sugar S57W 26.7'      do  
 Placed squared cedar post adjacent.  
 Bearings are magnetic. Distances are to notch in lower blaze.

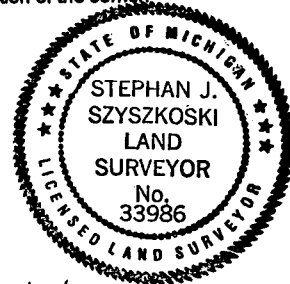

Signed by Stephan J. Szyszkoski  
 Surveyor's Michigan License No. 33986

Date 4/4/01

For the Michigan Department of Natural Resources - Forest Management Division