

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF -:	(DICKINSON COUNTY) LOCATED IN -:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. 40 N. R. 30 <input checked="" type="checkbox"/> W.	#J-3
2. PROPERTY CONTROLLING IN SECTION <u>2</u>	T. 40 N. R. 30 <input checked="" type="checkbox"/> W.	#15
3. MISCELLANEOUS PROPERTY IN SECTION <u>2</u>	T. 40 N. R. 30 <input checked="" type="checkbox"/> W.	
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on see below, 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on July 16, 19 79, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:

Corner J-3 (1/4 corner between Sections 2 & 11, T40N, R30W):
 Wood post (Not found. No subsequent monuments found.)
 Hemlock 6 S8E 30 (Not found. No subsequent accessories found.)
 W. Pine 14 N38E 15 (Probably found. No subsequent accessories found.)

Corner 15 (West 1/16 corner between Sections 2 & 11, T40N, R30W):
 Not established in original survey nor subsequently, apparently. Miscellaneous Property Corner: Not established in original survey nor subsequently, apparently.

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner:

Corner J-3: Restored 7-16-79 at record bearing and distance from a white pine stump believed to be the remains of an original BT, although no marks were found. Corner position thus established bears S89°46.4'W 39.978 ch. (record = 39.98 ch.) from an original sec. cor. to E and S89°47.8'E 39.983 ch. (record = 39.98 ch.) from a sec. cor. to W set by reference to surrounding landmarks of record. **Corner 15:** Established 7-24-79 on line between Sec. Cor. 19.9915 ch. W and 1/4 cor. 19.9915 ch. E. **Miscellaneous Property Corners:** On 7-16-79, set a 4" x 4" x 5' squared and scribed cedar post on true sec. line bet. Sec. 2 & 11, 9.996 ch. W of 1/4 post (declination 3°45' West) and a similar post on true sec. line bet. Sec. 2 & 11, 9.9945 ch. E of 1/4 post (declination 1°30' West). Not witnessed.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner J-3: 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap.
 Red Pine 10 (E'ly one of twins) N12-1/2°W (mag.) 128.5 ft. "1/4S, NBT"
 Red Pine 11 N36-1/2°E (mag.) 103.8 ft. "1/4S, NBT"
 Declination 1°55' West.

Corner 15: 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap.
 W. Spruce 11 N22°W (mag.) 64.0 ft. "1/16S, BT"
 W. Spruce 4 N47°E (mag.) 58.1 ft. "1/16S, BT"
 Declination 3°30' West.

SIGNED BY _____ DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. _____

(SEAL)


FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger DATE March 7, 1979

CHIEF OF SURVEY PARTY
 MICHIGAN REGISTERED LAND SURVEYOR

Arthur O. Enger
 Michigan Department of Natural Resources

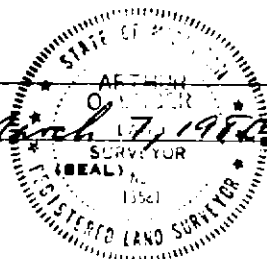

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581