

SURVEY & REMONUMENTATION

APR 27 1995

LAND CORNER RECORDATION CERTIFICATE
Filing Requirement of Act 74, Mich. P.A. 1970

RECORDED
034 JUN -8 10:247

For corner **COMMISSION**
Dickinson
(County)

Located In: Corner Code = 1-1

- 1. Public Land Survey Sec. 2 T 41N R 27W _____ I-1 _____
T _____ R _____
T _____ R _____
T _____ R _____
- 2. Property Controlling S _____ T _____ R _____
in Section S _____ T _____ R _____
- 3. Miscellaneous S _____ T _____ R _____
Property in Sec. S _____ T _____ R _____

ACCEPTED BY THE DICKINSON COUNTY SURVEY PEER GROUP AS THE OFFICIAL CORNER UNDER MICHIGAN PUBLIC ACT 345 OF 1990 AT A MEETING HELD ON 6-7-94

RFP

COUNTY REPRESENTATIVE

Register of Deeds Stamp & File Number

- 4. Lot No. _____, Recorded Plat _____
- 5. Private Claims _____

Northwest corner of Section 2, T41N, R27W

I, John R. Garske, in a field survey on April, 19 94, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a Court of Law and/or that the corner points mentioned in lines 3, 4 and 5 above were in conformance with the rules of the Michigan Board of Land Surveyors or by a Decree of a Court of Law; established, re-established, monumented, re-monumented, recovered, found as expressed below:

NOTE: Not more than 4 corners, all in the same town and range, may be recorded on this certificate.

	A	B	C	D	E	F	G	H	I	J	K	L	M
2	6	5	4	3	2	1							
3													
4	7	8	9	10	11	12							
5													
6	10	17	16	15	14	13							
7													
8	19	20	21	22	23	24							
9													
10	30	29	28	27	26	25							
11													
12	31	32	33	34	35	36							
13													

A. Description of original monument and accessories and/or subsequent restoration:

- 1846- Township boundary by Austin Burt; west 80.00 ch set cedar post. Hemlock 7, N73°E, 23 links. Fir 4, N77°W, 18 links.
- 1850- Township subdivision by MM Hall, Surveyor for John Burt, D.S.; North 81.70 ch. intersect north boundary 1.04 links west of post. Hemlock 12, 38°E, 12 links. Cedar 18, S55°W, 32 links.
- 1936- W.C. Johnson, Dickinson County Road Commission Surveyor; field notes show 10" cedar stump squared lying 2652.0 feet east of the one-quarter corner of Sections 34 and 3 and 2777.8 feet north of the one-quarter corner of Sections 3 and 2. Poplar 8", N08°-30'W, 52.7 feet. Poplar 8", N39°-30'W, 57.4 feet. Poplar 5", S21°-30'E, 39.8 feet.

B. Description of corner evidence found and/or method applied in restoring or reestablishing corner:

No evidence of original corner or accessories remain.

No evidence of W.C. Johnson's bearing trees remain.


I found a 1" hex head bolt 6" below gravel road surface set by persons unknown which lies 2658.25 feet east (2652' - W.C. Johnson) of the one-quarter corner of Sections 34 and 3 and 2766.53' (2777' - W.C. Johnson) north of the one-quarter corner of Sections 3 and 2. I accepted the bolt as the best available evidence for the section corner.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

I replaced hex bolt with a Dickinson County monument consisting of a 3/4" x 36" aluminum rod and a 2 1/2" stamped aluminum cap set 6" below surface of gravel road and established the following references:

- Ref. mon (stamped Dick. Co. Mon.) - N34°E, 39.00 feet
- Power Pole #85-20697 - S75°E, 99.67 feet
- Power Pole #85-20698 - S56°W, 43.53 feet
- Spruce 9" - N07°E, 55.52 feet (spruce had an old chest blaze and overgrown nail and washer)

Signed by John R Garske Date 5/2/94
Surveyor's Michigan License No. 28410

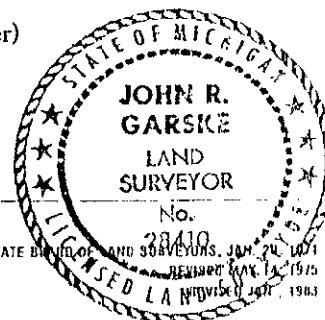

FORM APPROVED BY MICHIGAN STATE BOARD OF LAND SURVEYORS, JAN. 24, 1971
REVISED MAY 14, 1975
REVISED LA 11/16/97 1983

Libel 2 page 78