

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF --:	(DICKINSON COUNTY) LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>41</u> N. <u>X</u> , R. <u>28</u> W.	F-7 & G-7
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____ N. _____ S., R. _____ E. _____ W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. _____ S., R. _____ E. _____ W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on June 15, 1978, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:
Corner F7 (1/4 corner between Sections 16 & 21, T41N, R28W):
 Cedar post (Not found. No subsequent monuments found.)
 Hemlock 12 S37W 17 (Not found. No subsequent accessories found.)
 Cedar 16 N21E 20 (Not found. No subsequent accessories found.)

Corner G-7 (Section Corner 15, 16, 21, & 22, T41N, R28W):
 Ironwood post (Not found. No subsequent monuments found.)
 Sugar 18 S14E 33 (Not found. No subsequent accessories found.)
 Sugar 18 N62W 7 (Not found. No subsequent accessories found.)

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner: Corner F7: Restored proportionately on line between probable cedar line tree stump 9.384 ch. W and Sec. Cor. 40.015 ch. E. Thus set, corner bears S89°47.4'E 40.024 ch. from NW cor. Sec. 21 and N89°38.7'W 40.015 ch. from NE cor. Sec. 21. Corner G7: Restored by offsetting from the reconstructed original survey random line the calculated original survey distance, the said random line being oriented to the original field notes calls to streams, swamps, ridges, corners, and line tree for a distance of 3 miles to the W. Found a Keweenaw Land Co. location tag on a 4" maple S82°W 15.8 ft. from corner and a Northern Paper Mills location tag on a tree near a post S77°E 42.4 ft. from corner, indicating agreement by others that the area is the general corner location.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:
Corner F7: 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap
 Sugar Maple 5 N66°W (mag.) 15.9 ft. "1/4S, NBT"
 Sugar Maple 4 N 8°E (mag.) 13.9 ft. "1/4S, NBT"
 Declination 5°45' West

Corner G7: 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap.
 Sugar Maple 7 S15°W (mag.) 20.9 ft. "S21, NBT"
 Sugar Maple 9 N 9°E (mag.) 25.3 ft. "S15, NBT"
 Declination 5°35' West

SIGNED BY _____ DATE _____


SURVEYOR'S MICHIGAN REGISTRATION NO. _____ (SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger CHIEF OF SURVEY PARTY MICHIGAN REGISTERED LAND SURVEYOR DATE January 18, 1979

Arthur O. Enger
Michigan Department of Natural Resources

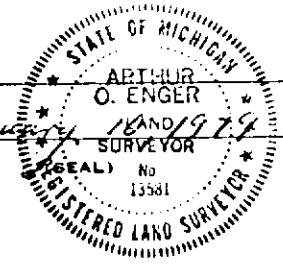

SURVEYOR'S MICHIGAN REGISTRATION NO. 13581