

LAND CORNER RECORDATION CERTIFICATE

FILING REQUIREMENT OF ACT 74, MICH. P.A.1970

FOR CORNERS OF --:	(DICKINSON COUNTY) LOCATED IN --:	CORNER CODE NUMBER
1. PUBLIC LAND SURVEY _____	T. <u>41</u> N. <u>X</u> , R. <u>28</u> <u>X</u> E. <u>W</u> .	D-5 & E-6
2. PROPERTY CONTROLLING IN SECTION _____	, T. _____ N. _____ S., R. _____ E. _____ W.	_____
3. MISCELLANEOUS PROPERTY IN SECTION _____	, T. _____ N. _____ S., R. _____ E. _____ W.	_____
4. LOT NO. _____, RECORDED PLAT _____		
5. PRIVATE CLAIMS _____		

REGISTER OF DEEDS STAMP AND FILING NUMBER

I, Arthur O. Enger, do hereby certify that under requirements of P.A. 74, Michigan P.A. of 1970, the corner points mentioned in lines 1 and 2 above were, in a field survey on see below, 19____, established, re-established, monumented, re-monumented, recovered or restored as expressed below and in conformance with regulations and rules therefore as required in the current manual of survey instructions of the United States Department of the Interior, Bureau of Land Management or by a decree of a court of law. Furthermore, that the corner points mentioned in lines 3, 4 and 5 above were, in a field survey on _____, 19____, found, recovered, restored, established or re-established as expressed below and in conformance with the rules of the Michigan State Board of Registration for Land Surveyors or, by a Decree of a Court of law:

A. Description of original monument and accessories and/or subsequent restoration:
Corner D5 (1/4 corner between Sections 8 & 17, T41N, R28W):
 Cedar post (Probably found. No subsequent monument found.)
 Y. Birch 10 S50E 26 (Probably found. No subsequent accessories found.)
 Hemlock 14 N75W 18 (Not found. No subsequent accessories found.)

Corner E6 (1/4 corner between Sections 16 & 17, T41N, R28W):
 Cedar post (Not found. No subsequent monuments found.)
 Cedar 10 S28E 32 (Not found. No subsequent accessories found.)
 Cedar 10 N61W 21 (Not found. No subsequent accessories found.)

B. Description of corner evidence found and/or method applied in restoring or re-establishing corner: Corner D5: Restored 5/8/78 at site of darkened streak of old post point in soil which bears N50°W 26 lks. from the rotted remains of a Y. Birch which was pointed out to me by Mr. Orville Hatle as being the original BT. The Y. Birch had been shown to him by Mr. J. L. Peterson, owner of the adjacent property and who had lived on it in excess of 70 years. Corner E6: Restored 7/12/78 by reconstructing the original survey random line bet. Sec. Cor. 4, 5, 32, & 33, T41-42N, R28W and the north stream crossing bet. Sec. 16 & 17. The distance bet. a swamp edge 8.00 ch. S of Sec. Cor. 4, 5, 8 & 9 and the north stream crossing agrees with the original distance. The original survey correction to true line was calculated and the corner re-established in like manner, resulting in the N 1/2-mile of this sec. line being N0°06.6'W 39.989 ch. and the S 1/2-mile being S0°13.5'E 39.996 ch.

C. Description of monument for corner and accessories established to perpetuate locating the position of the corner:

Corner D5: 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap.
 Sugar Maple 12 N13°W (mag.) 24.6 ft. "1/4S, NBT"
 Sugar Maple 7 S24°E (mag.) 22.9 ft. "1/4S, NBT"
 Declination is 3°50' West.

Corner E6: 1" I.D. x 36" iron pipe with 3 3/4" aluminum cap.
 Black Spruce 7 S36°W (mag.) 18.7 ft. "1/4S, NBT"
 White Birch 7 N88°E (mag.) 18.9 ft. "1/4S, NBT"
 Declination is 8°25' West.

SIGNED BY _____ DATE _____

SURVEYOR'S MICHIGAN REGISTRATION NO. _____


(SEAL)

FOR STATE AND UNITED STATES AGENCIES:

SIGNED BY _____ DATE _____

APPROVED AND SIGNED BY Arthur O. Enger
CHIEF OF SURVEY PART
MICHIGAN REGISTERED LAND SURVEYOR
 Arthur O. Enger

DATE August 14, 1978

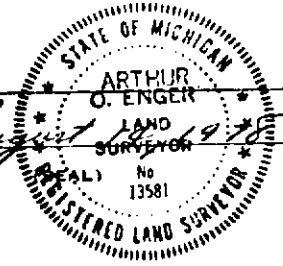

Michigan Department of Natural Resources
 SURVEYOR'S MICHIGAN REGISTRATION NO. 13581